

N865HC RIC

Photo's Dated: July 2, 2024

Cessna Citation 525

Serial number- 525-0616



Areas of visible damage:

1. Wing to body fairing panels

Right of centerline on bottom of aircraft with gouges and dents.




2. Right wing, bottom side, outboard of right main landing gear.

Lower wing structural panels gouged from forward moving impact damage.



3. Right wing, bottom side, forward of main landing gear.

Wing panel structure puncture into wing fuel tank and possible forward wing structural stringer. Undetermined condition of the wing structure other than evident structural surface contact to component from impact damage.

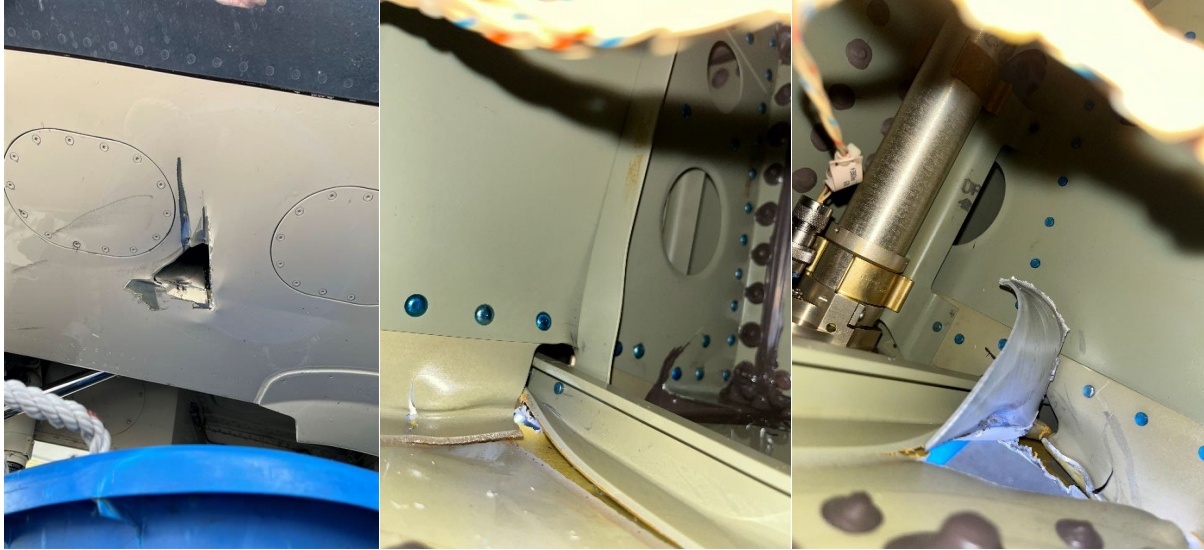

4. Right main landing gear.

Impact damage, consisting of a dent and gouge of main landing gear.



5. Right main landing gear flying gear door.
Impact damage to the gear flying door and hinge connected at main landing gear wheel well that compromised attachment structure.



6. Right wing trailing edge flap, inboard pylon.
Creased from impact damage.



7. Right wing trailing edge flap.
Creased and punctured in multiple places, outboard of the inboard flap pylon.



MARK B
JENNINGS

Digitally signed by MARK B
JENNINGS
Date: 2024.07.26 15:48:45
-04'00'