



WPR20LA304 Propeller Damage Observations Rev. A


Damage consistent with a tree strike wave-type bend


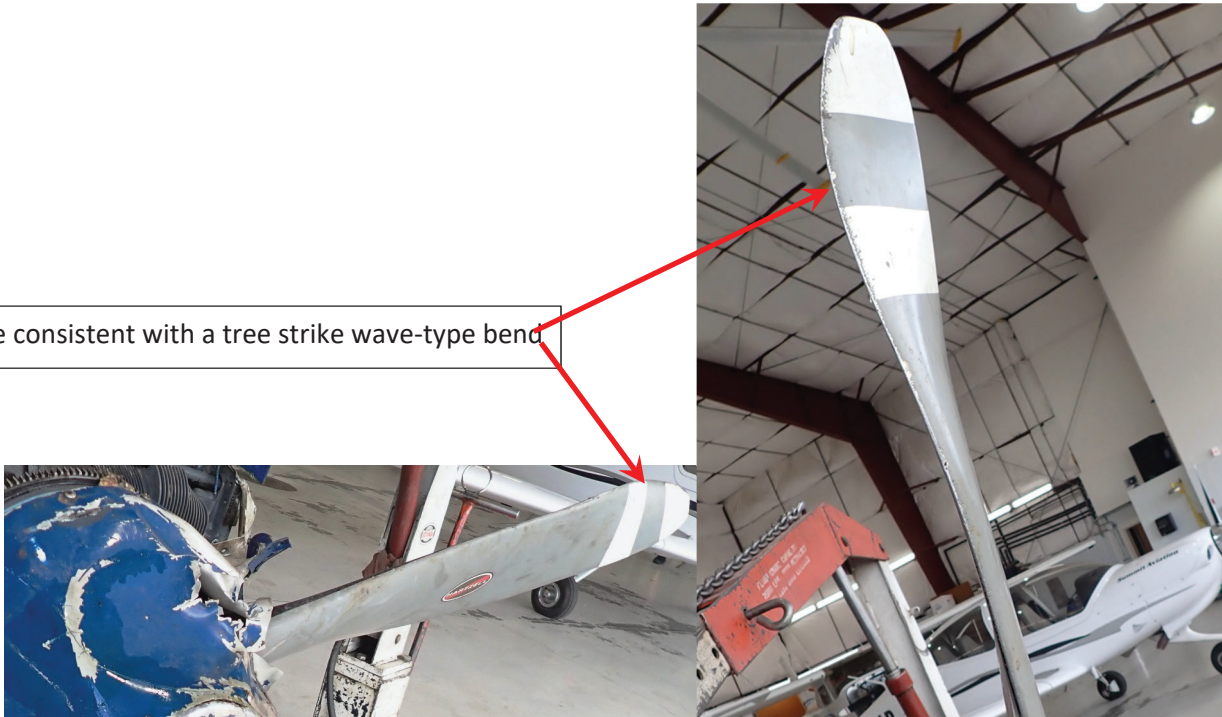



Chordwise/rotational
scoring on face side

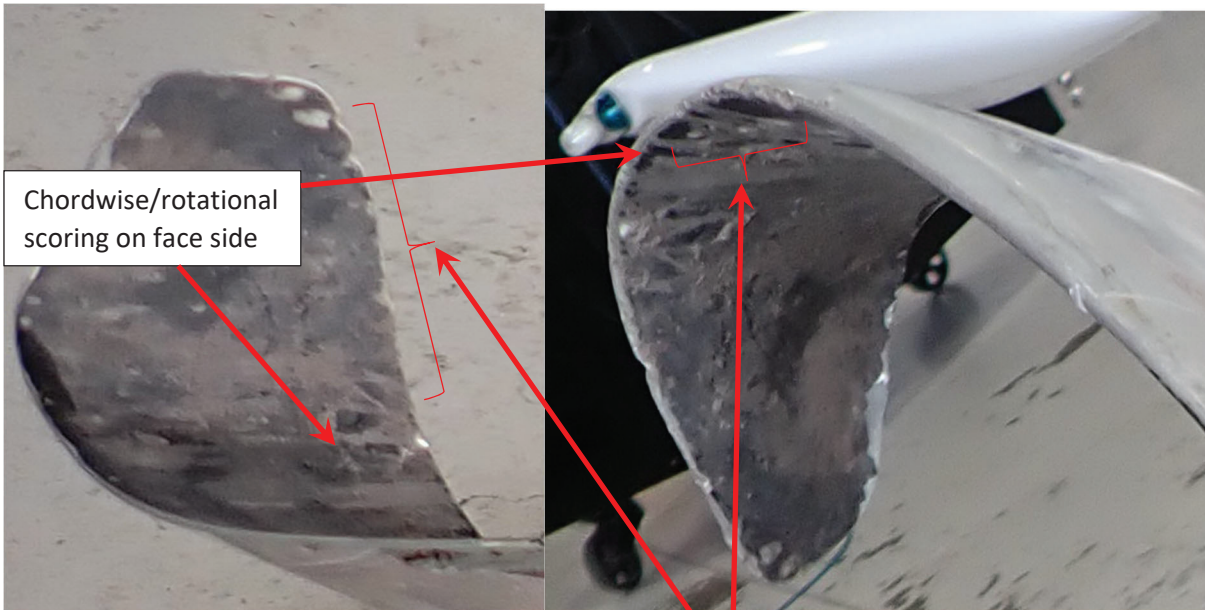


Leading edge gouges with material
deformation suggesting near-zero
angle of attack

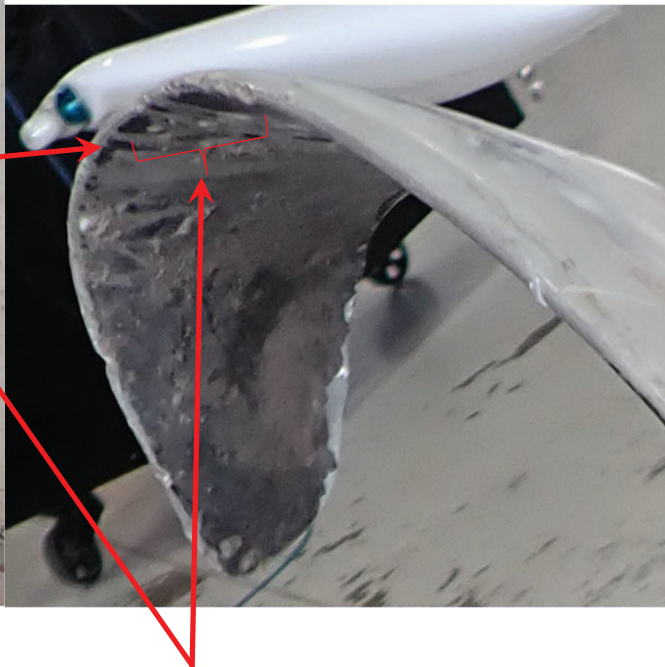

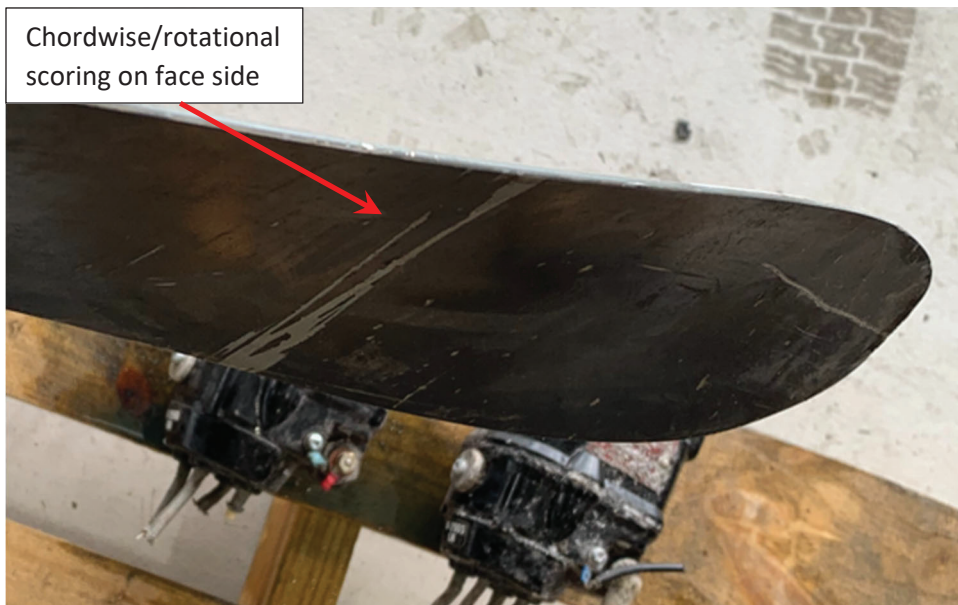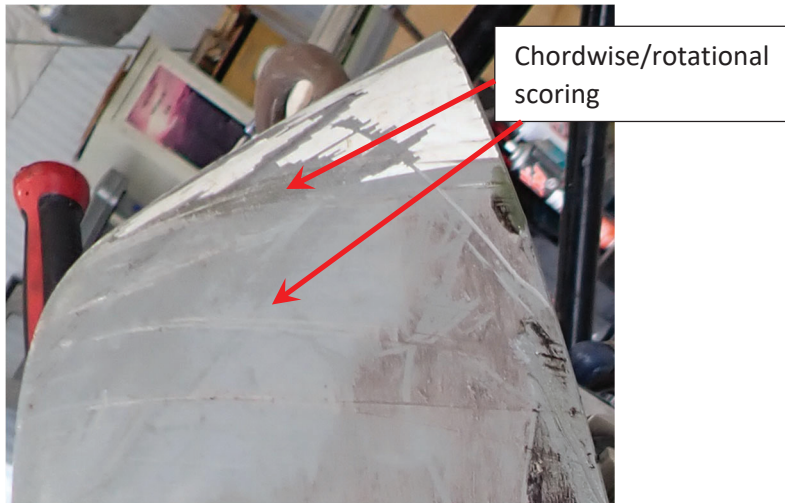

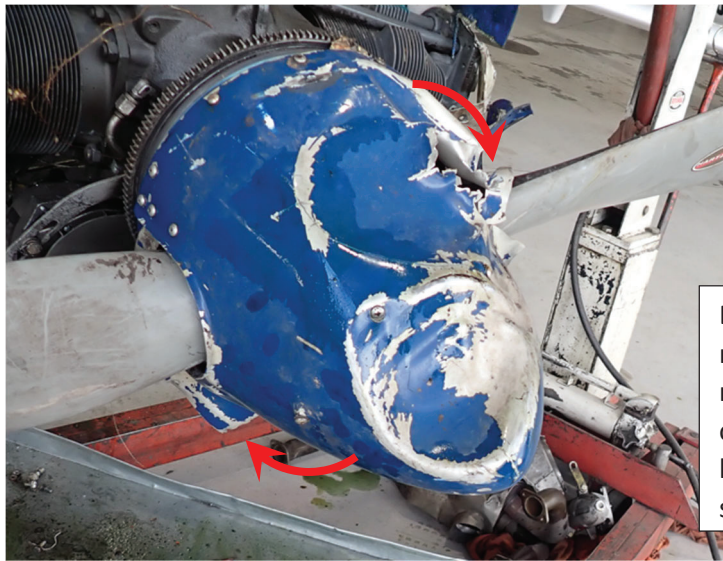

Damage in torsional/opposite rotation on spinner dome with material damage at leading edge of each blade. Contact marks on leading edge of blade at spinner/blade aperture

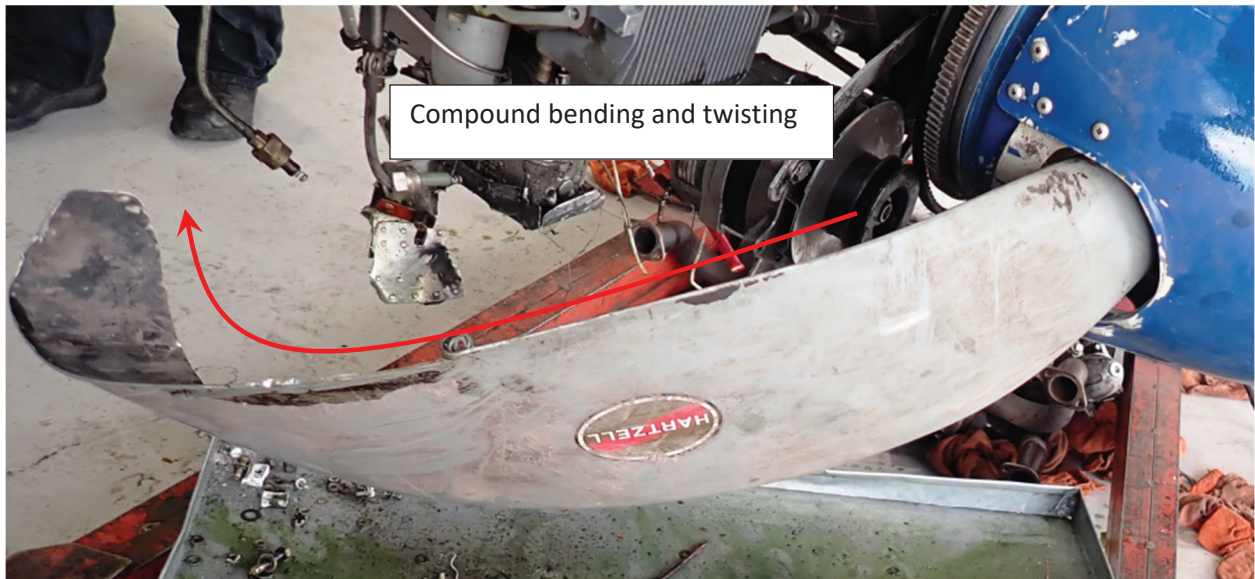

Compound bending and twisting