

MAINTENANCE RECORD

N714JE Date: 01/07/2021 Tach: 3253.1 AFTT: 3253.1

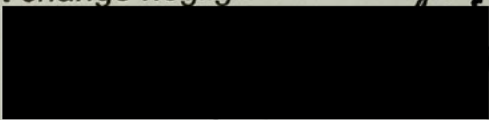
Replaced induction air filter with new BA-8103-1. Replaced all main landing gear brake liners with new APS 66-10500. Overhauled fuel strainer with McFarlane FS-KT-3 kit. Installed CO2 detector. Replaced missing hardware in tailcone. Replaced battery with new Gill G-243. Installed Cessna secondary seat stop in pilots seat rail. Installed new fire extinguisher with Halon H3 A344T. Replaced ELT battery with new and certified by Northern Lights Avionics, see w.o. 046941. Serviced wheel bearings with Aeroshell 22. Refer to separate A.D. listing for compliance.

I certify that I have inspected this Aircraft in accordance with an ANNUAL inspection and it was determined to be in airworthy condition.


ny Benavides

AUTHORIZED SIGNATURE,
CERTIFICATE TYPE
& NUMBER

MAINTENANCE RECORD

DATE 19__	TOTAL TIME IN SERVICE		DESCRIPTION OF THE WORK PERFORMED	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
	HOURS	10ths		
			N714JE Date: 1/15/2021 Tach: 3253.5 <i>Removed McCauley tailwheel assembly. Installed ABI 3400 8" tailwheel assembly with new hardware. Weight change negligible.</i>  Tony Benavides	

MAINTENANCE RECORD

DATE		TOTAL TIME IN SERVICE	DESCRIPTION OF THE WORK DONE	AUTHORIZED SIGNATURE, CERTIFICATE TYPE & NUMBER
19__	HOURS	HOURS		
			 Merrill Field INSTRUMENTS MORE THAN JUST INSTRUMENTS 940 Merrill Field Dr, Anchorage, AK 99501 PH. (907)278-5277 FAX. (907)279-0717 mfi@alaska.com	
			4/12/21 N714JE Removed old radios and instruments. Installed Garmin G3X as per STC#SA01899WI, see 337 dated this date. G3X installed with 10in display, and EIS option, plus 7in screen for the copilot side. Installed GTN650Xi as per STC# SA02019SE-D, see 337 dated this date. Installed GMA345 audio panel and wired in all new intercom positions. Installed GNC255 as com #2. Installed GTX345 as per STC# SA01714WI, see 337 dated this date. Installed GI275 ADHARS unit as standby as per STC#SA02658SE, see 337 dated this date. Replaced pilot and copilot panels with new. Replaced circuit breakers with new as required. Ground check good flight check required for operational check. [Redacted Signature] Merrill Field Instruments/Avionics Specialists [Redacted Signature]	

DATE	TOTAL TIME IN SERVICE	
	HOURS	10ths

N714JE

4/14/2021 TACH: _____

TTAF: _____

Performed wheel alignment using typical operating weight (full fuel and pilot, co-pilot). Confirmed LH wheel at 0." toe-in/out and 0 degree pos camber. Confirmed RH wheel at 1.25" toe out and 2 degrees pos camber. Adjusted shims to obtain toe in of .06" on RH wheel and 1 degrees pos camber. Alignment accomplished according to Chapter 5 of Cessna 180/185 series service manual., Performed taxi, and 2 takeoffs and landings with aircraft tracking satisfactory.

• Ben Wilkinson

ED SIGNATURE,
FICATE TYPE
NUMBER