

BERING AIR
AIRCRAFT STATUS SHEET

REGISTRATION N321BA

INSP. / PHASE DUE 4000.0

INSP. / PHASE # 800 Hour

AIRCRAFT UNAIRWOHY AT 4025.0

PITOT / STATIC DUE Nov 2024

ALTIMETER DUE Nov 2024

TRANSPONDER DUE Nov 2024

REWEIGH DUE Dec 2025

ELT BATTERY DUE Jan 2025

REGISTRATION DUE Mar 2028

REMARKS / NOTICES

100HR, 200HR, 200HR/12MO, 400HR/12MO, 400HR/24MO, 800HR/12MO, 800HR/24MO
Inspection C/w by Northland Aviation MAW Bering Air Inc CAMP and
is Returned to Service, [REDACTED] Hebb: 3979.0 08/29/24
[REDACTED] 8178

MAINTENANCE PROVIDER TRAINING FORM

Return this completed document to Bering Air's Quality Control Manager.

CONTACT EMAIL [REDACTED] CONTACT PHONE [REDACTED]

[illegible]

800 Hr 208B EX Inspection

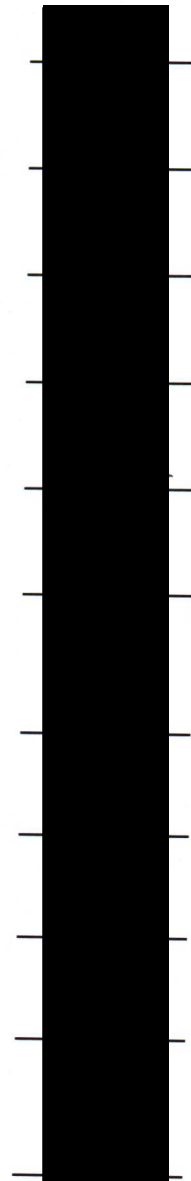
N: 321BA Hobbs: 3979.0 AFTT: 3979.0 Landings: 8178
 Unpaved Landings: N/A Airframe S/N: 208B5613 Date: 08/29/2024
 LH/Only Eng: PT6A-140 S/N: PCE-VA0701 ETT: 3979.0 ETC: 8178
 RH Eng: N/A S/N: N/A ETT: N/A ETC: N/A

Engine
PT6A-140

Task

Initial

- ~~1~~ Do visual inspection of all tubes and hose assemblies.
Ref: P&W -140 M/M Ch 70-00-00-200-801
- ~~2~~ Do a detailed Inspection of the propeller shaft oil seal for leakage.
Ref: P&W -140 M/M
- ~~3~~ Do a visual inspection of the engine externals.
Ref: P&W -140 M/M Ch 70-00-00-200
- ~~4~~ Do a visual inspection of the engine oil quantity.
Ref: P&W -140 M/M Ch 70-00-00-640
- ~~5~~ Do a check of the installation of the oil filler cap.
Ref: P&W -140 Ch 79-10-01-210
- ~~6~~ Do a visual inspection of the scavenge oil pump housing for leaks.
Ref: P&W -140 M/M Ch 70-00-00-200
- ~~7~~ Inspect inertial separator and linkages for condition/security of attachment
& Detailed Inspection
Ref: 208 M/M Ch 71-60-00
- ~~8~~ Do a visual inspection of the control linkages and wiring.
Ref: P&W -140 M/M Ch 72-00-00-212
- ~~9~~ Do a visual inspection of the engine exhaust duct for cracks.
Ref: P&W -140 M/M
- ~~10~~ Do a detailed inspection of turbine exhaust duct.
Ref: P&W -140 M/M Ch 72-50-05-210
- ~~11~~ Primary and Secondary Exhaust Duct General Visual Inspection. Zone 130
Ref: 208 M/M Task 78-10-00-211




Engine Continued
PT6A-140

Task

Initial

- ~~12~~ Do a visual inspection of the gas generator case end and the center fire seal.
Ref: P&W -140 M/M Ch 72-00-00-212
- ~~13~~ Do a visual inspection of the rear fire seal mounting ring.
Ref: P&W -140 M/M Ch 72-00-00-212
- ~~14~~ Do a visual inspection of the air inlet screen.
Ref: P&W -140 M/M Ch 72-20-01-212
- ~~15~~ Do a visual inspection with a mirror or a borescope of the 1st stage compressor rotor and the inlet case for corrosion.
Ref: P&W -140 M/M Ch 72-30-00-200
- ~~16~~ Do a visual inspection of the RGB and AGB chip detectors for debris.
Ref: P&W -140 M/M 79-30-01-210
- ~~17~~ Remove and inspect oil filter for debris. *Replaced - See Item # 10*
Ref: P&W -140 M/M Ch 79-20-01-000, 79-20-02-400, 79-20-01-160, 79-20-01-280
- ~~18~~ Standby Alternator Detailed Inspection. Zone 121
Ref: 208 M/M Task 24-36-00-220
- ~~19~~ Do a check of the fuel pump for installation and leaks.
Ref: P&W -140 M/M
- ~~20~~ Do a check of the oil-to-fuel heat exchanger for installation.
Ref: P&W -140 M/M
- ~~21~~ Do a visual inspection of the P3 filter and drain valve.
Ref: P&W -140 M/M 73-10-08-210 *- Replaced - See Item # 12*
- ~~22~~ Do a visual inspection of the ignition exciter.
Ref: P&W -140 M/M 74-10-01-210-801
- ~~23~~ Do a visual inspection of the ignition cables.
Ref: P&W -140 M/M 74-10-01-210-801
- ~~24~~ Do a functional check of the ignition cable.
Ref: P&W -140 M/M 74-20-01-750-801
- ~~25~~ Do a visual inspection of the spark igniter/glow plugs.
Ref: P&W -140 M/M 74-20-02-210-801

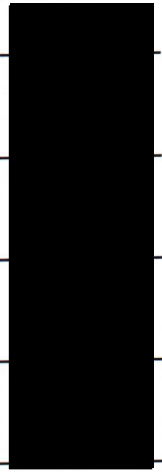
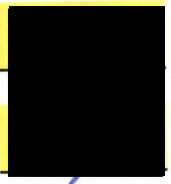
Engine Continued
PT6A-140

Task	Initial	RII
26 Engine Fire Detection System General Visual Inspection. Zone 121, 122 Ref: 208 M/M Task 26-10-00-210		
27 Engine Mounts and Firewall Detailed Inspection. Zone 130 Ref: 208 M/M Task 71-20-00-220		
28 Inspect the propeller governor beta valve. Ref: P&W -140 M/M 61-20-01-210-801		
29 Power Distribution Boxes Detailed Inspection. Zone 226, 232 Ref: 208 M/M Task 24-50-00-220		

Propeller
McCauley Model: 4HFR34C778, Blade: 102BHA-0

Task	Initial
1 Perform 100 Hour Propeller Inspection. Ref: McCauley Doc MPC26 Ch 61-00-06 & 61-10-45	

Landing Gear

Task	Initial		
	LH	RH	
1 Shimmy Damper Functional Check. Zone 710 Ref: 208 M/M Task 32-20-02-720			
2 Lubricate nose wheel bearings. Ref: 208 M/M Ch 32-40-00			
3 Verify balance of nose wheel assembly, balance if necessary. Ref: 208 M/M, Standard Practices			
4 NLG Yoke bearing inspection and lube Ref: Task 32-20-00-220 and Task 12-21-03-640			
5 Nose Landing Gear Detailed Inspection. Zone 710 Ref: 208 M/M Task 32-20-00-220			
			

Landing Gear Continued

Task	Initial	
	LH	RH
6 Inspect brake pads & disks for condition/security of attachment. Ref: 208 M/M Ch 32-40-00		
7 Inspect brake caliper pins for general condition, torque and security. Pins should have no movement after being torqued Ref: 208 M/M Ch 32		
8 Brake System Servicing. Zone 121 Ref: 208 M/M Task 12-10-01-610		
9 Brakes Operational Check. Zone ENG Ref: 208 M/M Task 32-40-00-710		
10 Grease Nose Torque Links and Nose Strut. Zone 700 Ref: 208 M/M Task 12-21-03-640		
11 Oil Shimmy Damper Pivot. Zone 700 Ref: 208 M/M Task 12-21-03-640		
12 Grease Main Wheel Bearings. Zone 700 Ref: 208 M/M Task 12-21-03-640		
13 Modified Steering Bungee Inspection Ref: Delcourt Aviation ICA # DA001		

Fuselage, Cabin

Task	Initial	
	LH	RH
1 Avionics Cooling Fan Operational Check. Zone 211, 212 Ref: 208 M/M Task 21-24-00-710		
2 Garmin Autopilot (GFC 700) Functional Check. Zone 226, 232 Ref: 208 M/M Task 22-12-00-720		
3 Garmin Autopilot (GFC 700) Slip Clutch Override Operational Check. Zone 226, 232 Ref: 208 M/M Task 22-12-00-710		
4 Inspect Portable Fire Extinguisher Ref: Bering Air GMM		

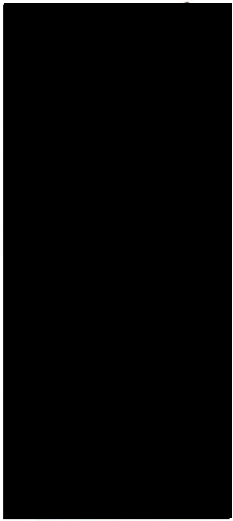

Fuselage, Cabin Continued

Task	Initial
5 Passenger Briefing System - Check briefing system for proper operation. Ref: HUCAB User Manual	
6 Perform Standby Flap Motor Ops Check. Ref: 208 M/M CH 27-50-00-720	
7 Emergency Power Lever Annunciator Light (EPL) Operational Check. Zone AUX Ref: 208 M/M Task 76-10-01-710	
8 Single Point Function Check - Verify condition, security & valve operation (no fuel truck needed, just program fuel into controller and confirm valves open after hitting start). Ref: Wipaire Inc Single Point Installation Manual & POH Supplement	
9 Engine Controls Functional Check. Zone 130, 211, 212, ENG Ref: 208 M/M Task 76-10-00-720	
10 Firewall Fuel Shutoff Valve Control Operational Check. Zone 213, 214, 220 Ref: 208 M/M Task 28-21-00-711	
11 Crew Seats Detailed Inspection. Zone 231, 232 Ref: 208 M/M Task 25-10-00-220	
12 Inertia Reel Operational Check. Zone 211, 232 Ref: 208 M/M Task 25-10-00-710	
13 Flap Actuator Mount Bracket Detailed Inspection. Zone 231, 232 Ref: 208 M/M Task 27-50-00-220	
14 Passenger/Cargo Compartment Lighting Operational Check. Zone AUX Ref: 208 M/M Task 33-20-00-710	
15 Crew Doors Detailed Inspection. Zone 801, 802 Ref: 208 M/M Task 52-00-00-220	
16 Inspect passenger seats for general condition & complete Seat Spot Check. Ref: AeroTwin Single Folding Seat STC & Bering Air GMM	
17 Inspect Pax Lower Door Struts are Charged by Removal & Reinstallation Ref: 208 M/M Ch 52	
18 Inspect Pax Lower Door Struts are Not Over Extended when Door Fully Open. Ref: Communique # SE-TP-004 & 208 M/M	

Fuselage, Cabin Continued

Task	Initial
19 Passenger/Cargo Doors and Door Frames Detailed Inspection. Zone 255, 256, 257, 258, 803, 804 Ref: 208 M/M Task 52-00-00-221	
20 Cargo Nets Detailed Inspection. Zone 251, 252, 255, 256, 257, 258 Ref: 208 M/M Task 25-51-00-220	
21 Verify Portable Scale Condition & Calibration Ref: Bering Air GMM	
22 Cargo Pod Drains Operational Check. Zone 901, 902, 903, 904, 905, 906 Ref: 208 M/M Task 25-52-00-710	
23 TKS Anti-Ice System Functional Check. Zone AUX Ref: 208 M/M Task 30-11-00-720	
24 TKS System Pressure and Flow Functional Check. Zone AUX Ref: 208 M/M Task 30-11-00-722	
25 Elevator Bellcrank Lubrication. Zone 213, 214 Ref: 208 M/M Task 12-21-02-640	

Wings

Task	Initial		RII	
	LH	RH	LH	RH
1 Flight Controls Lubrication. Zone 215, 216, 226, 373, 374, 503, 525, 603, 625 Ref: 208 M/M Task 27-00-00-640				
2 Stall Warning System Operational Check. Zone 211, 212, 503 Ref: 208 M/M Task 27-31-00-710				
3 Pitot Tube Heaters Operational Check. Zone AUX Ref: 208 M/M Task 34-11-00-710				
5 Fuel Reservoir Warning System Operational Check. Zone ENG Ref: 208 M/M Task 28-41-00-710, 1.95-2.15 gal				
6 Fuel Quantity and Low Fuel Warning Systems Functional Check. Zone AUX NOTE: RII is for Installation of fuel line after draining. Ref: 208 M/M Task 28-41-00-720				

Wings Continued

Task	Initial	
	LH	RH
7 Wing Shutoff Valve Linkage Lubrication. Zone 231, 232, 511, 611 Ref: 208 M/M Task 28-23-00-640		
8 Flap Tracks and Rollers Lubrication. Zone 525, 527, 625, 627 Ref: 208 M/M Task 27-50-00-640		
9 Aileron Trim System Lubrication. Zone 211, 212, 217, 218, 233, 234, 253, 254, 251, 252, 551, 571, 651, 671 Ref: 208 M/M Task 27-10-02-640		
10 Aileron Trim Tab (Free Play) Functional Check. Zone 551, 571, 651, 671 Ref: 208 M/M Task 27-10-02-720		
11 Spoiler System Functional Check. Zone 211, 212, 217, 218, 233, 234, 253, 254, 251, 252, 503, 525, 603, 625 Ref: 208 M/M Task 27-10-00-720		
12 Flap Bellcrank Detailed Inspection. Zone 251, 252, 511, 611, 525, 625 Ref: 208 M/M Task 27-50-00-221		
13 Fuel Vent Line Float Valve Operational Check. Zone 575, 675 Ref: 208 M/M Task 28-10-03-710		
14 Fuel Filler Assembly Detailed Inspection. Zone 521, 621 Ref: 208 M/M Task 28-10-01-220		
15 Sump all fuel tank drains. Ref: 208 POH		

Tail

Task

Initial
LH RH

- 1 Rudder Gust Lock - Inspect condition and general operation.
Ref: Aero Twin Gust Lock Kit ICA Doc # AT-RL-1001 ICA
- 2 Elevator Trim Tab (Free Play) Functional Check. Zone 371, 372, 375, 376
Ref: 208 M/M Task 27-30-02-720
- 3 Inspect vertical stabilizer to rudder bonding straps for condition, security of attachment, and chafing.
Ref: 208 M/M CH 20, 27

General Inspection Items

Task

Initial

- 1 Interior and Exterior Placard and Decal Detailed Inspection. Zone ALL
Ref: 208 M/M Task 11-00-00-220
- 2 Static Discharge System Functional Check. Zone 343, 375, 376, 571, 671
Ref: 208 M/M Task 23-60-00-720
- 3 Audit and correct math error Flight Record & Remove Complete Blue Copies.
Ref: Bering Air GMM

Hobbs: 3979.0 Landings: 8178

- 4 Check Status of G1000 Databases/ Update if needed or if updates are available.
Ref: 208 Garmin G1000 Line Maintenance Manual & Bering Air GMM
- 5 Verify All RII Functions Have Been Completed at the Completion of this Inspection Packet
Ref: Bering Air CAMP Manual
- 6 Placard Hobbs Meter with Inspection Due Time "4100.0"
Ref: Bering Air GMM
- 7 Update Bering Air Aircraft Status Sheet in Aircraft/Tin.
Ref: Bering Air GMM
- 8 Complete post maintenance walk around inspection (pre-flight type inspection) at the completion of the inspection with extra focus on areas where maintenance was performed during the inspection.
Ref: 208 POH
- 9 Verify aircraft Registration and Airworthiness Certificate are installed in the aircraft, legible, and Registration not expired.

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# <u>1</u>	Time Item or Discrepancy Perform Battery Capacity Check & Record Results (%) Ref: Concord RG Series M/M	Name of Person Recording Discrepancy Jeremy
Corrective Action Performed Capacity Check IAW Concord M/M Battery (Passed/Failed): <u>PASSED</u> Capacity Results (%): <u>86.7%</u> Mechanic Signature & Certificate #  RII Signature & Certificate #  Pass or Fail <u>P</u>		

Item# <u>2</u>	Time Item or Discrepancy Aero Twin 1000 Hr Folding Seat Inspection Ref: Aero Twin ICA P/N: ATFS1-ICA1	Name of Person Recording Discrepancy Jeremy
Corrective Action INSPECTED SEATS IAW Aero Twin ICA #ATFS1-ICA1 Seats good Mechanic Signature & Certificate #  RII Signature & Certificate #  Pass or Fail <u>P</u>		

Item# <u>3</u>	Time Item or Discrepancy NLG Gravel Deflector 100 Hr Inspection Ref: Nose Gear Gravel Deflector ICA # NGD8-ICA	Name of Person Recording Discrepancy Jeremy
Corrective Action NLG Gravel Deflector Inspection IAW Above Ref- No Defects Noted Mechanic Signature & Certificate #  RII Signature & Certificate #  Pass or Fail <u>P</u>		

BERING AIR INC.
PO BOX 1650
NOME, AK 99762


100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# 4	Time Item or Discrepancy GI 275 Electrical Bonding Check Ref: Garmin GI 275 STC M/M CH 3	Name of Person Recording Discrepancy Jeremy
Corrective Action 275 Bonding check CW IAW Above Ref - No Defects		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 5	Time Item or Discrepancy Replace Starter/Generator (Overhaul) & Inspect QAD Flange S/N: 3096XL Ref: 208 M/M CH 80-10-00	Name of Person Recording Discrepancy Jeremy
Corrective Action Replace Starter/Generator SN 3096XL with Overhauled one SN 4548XL IAW Above Ref - Ops checked sat - QAD Flange inspected Good		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 6	Time Item or Discrepancy Flow Check Fuel Nozzles / Borescope Insp Ref: P&W M/M	Name of Person Recording Discrepancy Jeremy
Corrective Action Duplex Fuel Manifold/Nozzle Assy Cleaned, Inspected, Leak checked & Flow Tested S/B 1752 CW by Heritage Turbines Inc W# Fairbanks 35000 - No Defects Noted Installed Fuel Manifold Assy IAW P&W PTGA-140 MM 73-10-04 - Borescope CW IAW P&W PTGA-116R3		
Mechanic Signature & Certificate # 		
		Pass or Fail PASS

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

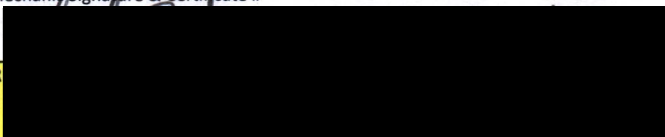

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo

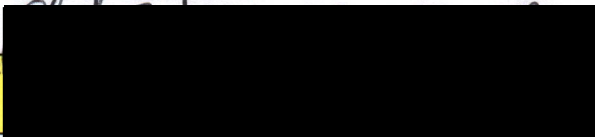

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# <u>7</u>	Time Item or Discrepancy Perform Engine Wash Ref: P&W M/M 71-00-00	Name of Person Recording Discrepancy Jeremy	
Corrective Action <i>Performed Engine Performance Recovery Wash IAW P&W PT6A-140-MM 71-00-00 - No Defects Noted</i>			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail 

Item# <u>8</u>	Time Item or Discrepancy Insp Engine Fuel Pump Inlet Screen & Insp/Replace Outlet Filter Ref P&W CH 73-10-05	Name of Person Recording Discrepancy Jeremy	
Corrective Action <i>Removed Fuel Pump Inlet Screen, Inspected & Reinstalled - Removed/ Replaced Outlet Filter with a New One IAW Above Ref - No Defects Noted</i>			
Mechanic Signature & Certificate # 			
R 			Pass or Fail PASS

Item# <u>9</u>	Time Item or Discrepancy Insp & Replace Fuel/Oil Heat Exchanger Fuel Filter Ref: P&W CH 73-10-05	Name of Person Recording Discrepancy Jeremy	
Corrective Action <i>Removed, Inspected & Replaced Fuel/Oil Heater Filter with a New IAW Above Ref - No Defects Noted</i>			
Mechanic Signature & Certificate # 			
R 			Pass or Fail PASS

BERING AIR INC.
PO BOX 1650
NOME, AK 99762


100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# 10	Time Item or Discrepancy Change Engine Oil Filter Ref: P&W M/M	Name of Person Recording Discrepancy Jeremy
Corrective Action Removed & Replaced Eng Oil Filter Element with a New One IAW P&W PT6A-140 MM 79-20-01 - Leak Check Sat		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 11	Time Item or Discrepancy AGB Internal Oil Scavenge Pump Inlet Screen Inspection Ref: P&W 79-30-01-210-803	Name of Person Recording Discrepancy Jeremy
Corrective Action AGB Internal Oil Scavenge Pump Inlet Screen Inspected IAW Aban Ref- No Defects Noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 12	Time Item or Discrepancy Change P3 filter Ref: P&W M/M	Name of Person Recording Discrepancy Jeremy
Corrective Action Removed & Replaced Eng P3 Air Filter with a New One IAW P&W PT6A-140 MM 73-10-08 - Leak checked Sat		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 


BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# 13	Time Item or Discrepancy G1000 Nxi Software V2499.12 Upgrade Ref. CAB 34-14 Rev 0	Name of Person Recording Discrepancy Jeremy	
Corrective Action New Software Card V2499.12 still on Backorder - will p/w af a later Date.			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail 

Item# 14	Time Item or Discrepancy Return to Service Sign-Off	Name of Person Recording Discrepancy Jeremy	
Corrective Action 100 Hr, 200 Hr, 200 Hr/12 Mo, 400 Hr/12 Mo, 400 Hr/24 Mo, 800 Hr/12 Mo, 800 Hr/24 Mo Inspection was completed I certify that this aircraft has been inspected in accordance with Bering Air, Inc Continuous Airworthiness Maintenance Program (CAMP) and is approved to return to service at this time.			
Date: <u>08/29/2024</u> Hobbs: <u>3979.0</u> AFTT: <u>3979.0</u> Cycles: <u>8178</u>			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail 

Item# 15	Time Item or Discrepancy Cargo Pod Heat Deflector Detaminating	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Re-Bonded Cargo Pod Heat Deflector as Required IAW C208B MM 25-52-01 - No Defects Noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail 

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo


AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/27/2024
AFTT 3979.0
CYCLES 8178

Item# 16	Time Item or Discrepancy Stiffener AFT Baggage on RT Side Damaged	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced stiffener with new part. C208B SRM 51-40-00			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 		Pass or Fail X	

Item# 17	Time Item or Discrepancy Window Molding on AFT LT Side Baggage Area Damaged	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced molding with new of same C-208B mm 25-23-00			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 		Pass or Fail X	

Item# 18	Time Item or Discrepancy RT & LT AFT Windows Leaking	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Rescaled AFT Cargo Windows Exterior Seams IAW C208B MM 56-20-00 - No Defects Noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 		Pass or Fail e	


BERING AIR INC.
PO BOX 1650
NOME, AK 99762

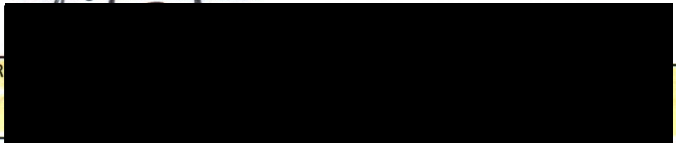

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# 19	Time Item or Discrepancy Pilot Door Seal Missing on Lower Corner	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced Door Seal as needed. C-208B - 52-11-00			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 		Pass or Fail X	

Item# 20	Time Item or Discrepancy Propeller Feedback Control Rod Bolt Busted at FWD End	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced Propeller Governor Interconnect Rod to FWD BETA Cable Connection Clamp/Bolt with a New One & Verified Rigging IAW C208B MM 76-12-05 - No Defects Noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 		Pass or Fail PASS	

Item# 21	Time Item or Discrepancy Propeller Blade #2 TKS Nozzle Worn into by Spinner	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced Prop TKS Nozzle with a New One IAW C208B MM 30-61-00 - No Defects Noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 		Pass or Fail 2	

BERING AIR INC.
PO BOX 1650
NOME, AK 99762


100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo


AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# 22	Time Item or Discrepancy Propeller Needs to be Dressed	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Dressed Propeller IAW ALC Cauley Field Repair Service Memo: PRODSOP-16-38-COB - No Defects Noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # e			Pass or Fail e

Item# 23	Time Item or Discrepancy LT AFT Baggage Overhead Light Not Working	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replace Bulb with serviceable part OAS ck good worked done IAW CESSNA 208 man chap 38-25-00			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail X

Item# 24	Time Item or Discrepancy Separator FWD Door Bushings Worn	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced 2ea Bushings with New Ones IAW C208B MM 71-60-00 - No Defects Noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # e			Pass or Fail e

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo


AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 08/29/2024
AFTT 3979.0
CYCLES 8178

Item# 25	Time Item or Discrepancy Standby Gen Drive Belt Loose / Wrong Hardware	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Replaced Incorrect Hardware with Proper Hardware & Repaired Threads as Required IAW C208B SRM 51-00-00 & Tensioned Drive Belt IAW C208 MM 24-36-00 - No Defects Noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 


Item# 26	Time Item or Discrepancy LT MGS Brake Linings Worn Beyond Limits	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Replaced Brake Linings with New Ones IAW C208B MM 32-40-00 - No Defects Noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 27	Time Item or Discrepancy Multiple Cargo Doors are Damaged into the Honey Comb	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Repaired Damage in Cargo Pod Doors IAW C208B MM 25-52-00 - No Defects Noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

MAINTENANCE DISCREPANCY SHEET

100
200
400
800

N# 321BA
DATE 8/29/24
AFTT 3979.0
CYCLES 8178.0

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy	
28	Pilot & Co-Pilot Lower Step Hardware Missing/Loose	Christopher Rife	
Corrective Action Replaced hardware as needed. IAW C208B MM 52-61-00			
		Mechanic Signature & Certificate # 	
		RII Signature & Certificate # 	Pass or Fail 

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy	
29	Pilot Stairs Grip Tape Needs Replaced	Christopher Rife	
Corrective Action Replaced GNP TAPE AS needed C-208 B 52-11-00			
		Mechanic Signature & Certificate # 	
		RII Signature & Certificate # 	Pass or Fail 

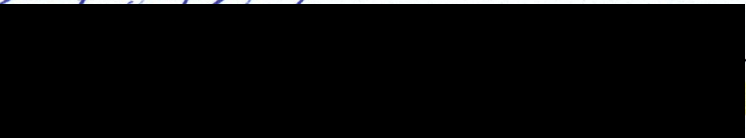
Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy	
30	Exhaust Cowl Patch Chafed Through	Christopher Rife	
Corrective Action Removed chafed/cracked Exhaust Structure Repair & installed a New One IAW CAB 78-03			
		Mechanic Signature & Certificate # 	
		RII Signature & Certificate # 	Pass or Fail 

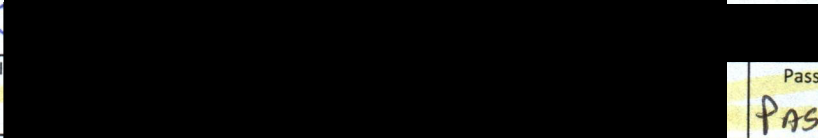
BERING AIR INC.
PO BOX 1650
NOME, AK 99762


MAINTENANCE DISCREPANCY SHEET

100
200
400
800

N# 321BA
DATE 8/29/24
AFTT 3979.0
CYCLES 8178

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
31	LT AFT Aileron Rod End Worn Out	Christopher Rife
Corrective Action		
Replace Left AFT Aileron Rod end with New, work done IAW 208 Cessna MM Chap 57-60-00		
Mechanic Signature & Certificate #		
		
R		Pass or Fail
		PASS

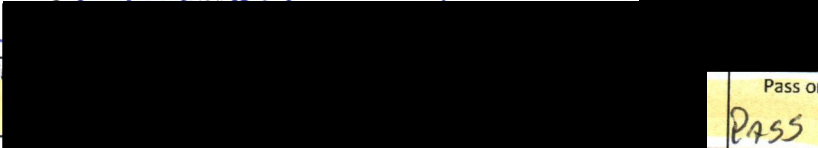

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
32	LT AFT Spoiler Rod End Worn Out	Christopher Rife
Corrective Action		
Replace Left AFT Spoiler Rod end with New, work done IAW Cessna 208 MM Chap 57-70-00		
Mechanic Signature & Certificate #		
		
R		Pass or Fail
		PASS



Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
33	Lower PAX Door Inner Handle Cracked	Christopher Rife
Corrective Action		
Welded Crack in Lower PAX Door Handle as Required IAW C208B SRM 51-74-00. Installed Handle IAW C208B MM 51-12-00 - No Defects Noted		
Mechanic Signature & Certificate #		
		
R		Pass or Fail
		PASS


MAINTENANCE DISCREPANCY SHEET

100
200
400
800

N# 321BA
DATE 8/22/24
AFTT 3979.0
CYCLES 8178

Item# 34	Time Item or Discrepancy RT Spoiler Hinge Pins Worn Out	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Replace Right wing spoiler Hinge pins with New, work done IAW Cessna 208 MM chap 57-70-00		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail PASS

Item# 35	Time Item or Discrepancy RT Aileron FWD & AFT Rod Ends Worn Out	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Replace Forward and AFT Aileron Rod ends on Right wing with New, work done IAW Cessna 208 MM chapter 57-60-00		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail PASS

Item# 36	Time Item or Discrepancy Rudder Stops are Not Safety Wired	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Safety Wired Rudder Stops at AFT Bulkhead as Required IAW C208B MM 27-20-01 - No Defects Noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail PASS

MAINTENANCE DISCREPANCY SHEET

100
200
400
600

N# 321BA
DATE 8/29/24
AFTT 3979.0
CYCLES 8178

Item# <u>37</u>	Time Item or Discrepancy <u>Rudder has Working Rivets on LT Side @ WL 176.00</u>	Name of Person Recording Discrepancy <u>Christopher Rife</u>	
Corrective Action <u>Replaced Working Rivets with New ones IAW C208B</u> <u>SRM 51-40-00 - No Defects Noted</u>			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # <u>[Signature]</u>			Pass or Fail <u>P</u>

Item# <u>38</u>	Time Item or Discrepancy <u>RT INBD Flap Rod End Rusted</u>	Name of Person Recording Discrepancy <u>Christopher Rife</u>	
Corrective Action <u>Replace INBOARD Flap Rod end on right wing with New</u> <u>work done IAW CESSNA 208 Manual Chap 57-60-00</u>			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail <u>PASS</u>

Item# <u>39</u>	Time Item or Discrepancy <u>PAX Entrance Thrush Hold Strip has Stripped Bolt Holes</u>	Name of Person Recording Discrepancy <u>Christopher Rife</u>	
Corrective Action <u>Replaced bad NUT PLATES with New PARTS.</u> <u>C208B SRM 51-40-00</u>			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # <u>[Signature]</u>			Pass or Fail <u>[Signature]</u>

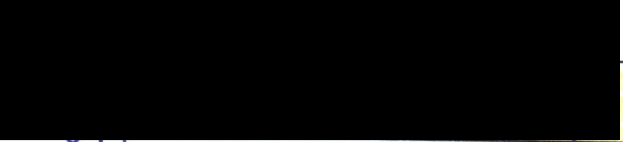

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

MAINTENANCE DISCREPANCY SHEET

100
200
400
800

N# 321BA
DATE 8/29/24
AFTT 3979.0
CYCLES 8178

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy	
40	LT & RT MLG Wheel Grease Seal C-Clips are Knife Edge	Christopher Rife	
Corrective Action			
Replaced 4ea LT/RT MLG Wheel Assy Grease Seal C-Clips with New ones IAW C208B MM 32-40-05 - No Defects Noted			
Mechanic Signature & Certificate #			
			
R/I Signature & Certificate #			Pass or Fail
			

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy	
41	Rudder Cable Tension are Low	Christopher Rife	
Corrective Action			
ADJUSTED CABLE TENSION AND INSTALL CLIPS C-208B MM 27-20-00			
Mechanic Signature & Certificate #			
			
R/I Signature & Certificate #			Pass or Fail
			PASS

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy	
42	RT Brake Master Cylinder Leaking	Christopher Rife	
Corrective Action			
Remove brake master cyl, disassemble, clean, replace packings with New Reassemble and install Leak ck good work done IAW CESSNA 208 MM chap 32-41-08			
Mechanic Signature & Certificate #			
			
R/I Signature & Certificate #			Pass or Fail
			