

BERING AIR
AIRCRAFT STATUS SHEET

REGISTRATION N321BA

INSP. / PHASE DUE 3200.0

AIRCRAFT UNAIRWORTHY AT 3225.0

PITOT / STATIC DUE Nov 2024

TRANSPONDER DUE Nov 2024

ELT BATTERY DUE Jan 2025

INSP. / PHASE # 1600 Hr / 24 & 60 mo

ALTIMETER DUE Nov 2024

REWEIGH DUE Dec 2025

REGISTRATION DUE Mar 2028

REMARKS / NOTICES

C/W 12 mo, 100 hr, 200 hr, 200 hr 12 mo, 400 hr 12 & 24 mo, 800 hr 12 & 24 mo
1600, 24 & 60 mo

12/8/2023



AFH: 31975

Ldg: 6606 FAI

12 mo

100 Hr

200 Hr

200 Hr / 12 mo

400 Hr / 12 & 24 mo

800 Hr / 12 & 24 mo

MAINTENANCE PROVIDER TRAINING FORM

This document will be used to validate that training has occurred. Each individual signing this form certifies that they have received training on Bering Air policies and procedures and that they understand the materials.

COMPANY NAME

Northland Aviation Services

MAINTENANCE SUPERVISOR

James Pease

CONTACT EMAIL

CONTACT PHONE

[illegible]

1600 Hr 208B EX Inspection

N: 321BA Hobbs: 3197.5 AFTT: 3197.5 Landings: 6606
Unpaved Landings: N/A Airframe S/N: 208B5613 Date: 12/8/23
LH/Only Eng: PT6A-140 S/N: PCE-VA0701 ETT: 3197.5 ETC: 6606
RH Eng: N/A S/N: N/A ETT: N/A ETC: N/A

Engine
PT6A-140

Task

Initial

- 1 Do visual inspection of all tubes and hose assemblies.
Ref: P&W -140 M/M Ch 70-00-00-200-801
- 2 Do a detailed Inspection of the propeller shaft oil seal for leakage.
Ref: P&W -140 M/M
- 3 Do a visual inspection of the engine externals.
Ref: P&W -140 M/M Ch 70-00-00-200
- 4 Do a visual inspection of the engine oil quantity.
Ref: P&W -140 M/M Ch 70-00-00-640
- 5 Do a check of the installation of the oil filler cap.
Ref: P&W -140 Ch 79-10-01-210
- 6 Do a visual inspection of the scavenge oil pump housing for leaks.
Ref: P&W -140 M/M Ch 70-00-00-200
- 7 Inspect inertial separator and linkages for condition/security of attachment
& Detailed Inspection
Ref: 208 M/M Ch 71-60-00
- 8 Do a visual inspection of the control linkages and wiring.
Ref: P&W -140 M/M Ch 72-00-00-212
- 9 Do a visual inspection of the engine exhaust duct for cracks.
Ref: P&W -140 M/M
- 10 Do a detailed inspection of turbine exhaust duct.
Ref: P&W -140 M/M Ch 72-50-05-210
- 11 Primary and Secondary Exhaust Duct General Visual Inspection. Zone 130
Ref: 208 M/M Task 78-10-00-211

Engine Continued
PT6A-140

Task

Initial

- 12** Do a visual inspection of the gas generator case end and the center fire seal.
Ref: P&W -140 M/M Ch 72-00-00-212
- 13** Do a visual inspection of the rear fire seal mounting ring.
Ref: P&W -140 M/M Ch 72-00-00-212
- 14** Do a visual inspection of the air inlet screen.
Ref: P&W -140 M/M Ch 72-20-01-212
- 15** Do a visual inspection with a mirror or a borescope of the 1st stage compressor rotor and the inlet case for corrosion.
Ref: P&W -140 M/M Ch 72-30-00-200
- 16** Do a visual inspection of the RGB and AGB chip detectors for debris.
Ref: P&W -140 M/M 79-30-01-210
- 17** Remove and inspect oil filter for debris.
Ref: P&W -140 M/M Ch 79-20-01-000, 79-20-02-400, 79-20-01-160, 79-20-01-280
- 18** Standby Alternator Detailed Inspection. Zone 121
Ref: 208 M/M Task 24-36-00-220
- 19** Do a check of the fuel pump for installation and leaks.
Ref: P&W -140 M/M
- 20** Do a check of the oil-to-fuel heat exchanger for installation.
Ref: P&W -140 M/M
- 21** Do a visual inspection of the P3 filter and drain valve.
Ref: P&W -140 M/M 73-10-08-210
- 22** Do a visual inspection of the ignition exciter.
Ref: P&W -140 M/M 74-10-01-210-801
- 23** Do a visual inspection of the ignition cables.
Ref: P&W -140 M/M 74-10-01-210-801
- 24** Do a functional check of the ignition cable.
Ref: P&W -140 M/M 74-20-01-750-801
- 25** Do a visual inspection of the spark igniter/glow plugs.
Ref: P&W -140 M/M 74-20-02-210-801

Engine Continued
PT6A-140

Task

Initial

RII

26 Engine Fire Detection System General Visual Inspection. Zone 121, 122
Ref: 208 M/M Task 26-10-00-210

27 Engine Mounts and Firewall Detailed Inspection. Zone 130
Ref: 208 M/M Task 71-20-00-220

28 Inspect the propeller governor beta valve.
Ref: P&W -140 M/M 61-20-01-210-801

29 Power Distribution Boxes Detailed Inspection. Zone 226, 232
Ref: 208 M/M Task 24-50-00-220

Propeller
McCauley Model: 4HFR34C778, Blade: 102BHA-0

Task

Initial

1 Perform 100 Hour Propeller Inspection.
Ref: McCauley Doc MPC26 Ch 61-00-06 & 61-10-45

Landing Gear

Task

Initial
LH RH

1 Shimmy Damper Functional Check. Zone 710
Ref: 208 M/M Task 32-20-02-720

2 Lubricate nose wheel bearings.
Ref: 208 M/M Ch 32-40-00

3 Verify balance of nose wheel assembly, balance if necessary.
Ref: 208 M/M, Standard Practices

4 NLG Yoke bearing inspection and lube
Ref: Task 32-20-00-220 and Task 12-21-03-640

5 Nose Landing Gear Detailed Inspection. Zone 710
Ref: 208 M/M Task 32-20-00-220

Landing Gear Continued

Task	Initial	
	LH	RH
6 Inspect brake pads & disks for condition/security of attachment. Ref: 208 M/M Ch 32-40-00		
7 Inspect brake caliper pins for general condition, torque and security. Pins should have no movement after being torqued Ref: 208 M/M Ch 32		
8 Brake System Servicing. Zone 121 Ref: 208 M/M Task 12-10-01-610		
9 Brakes Operational Check. Zone ENG Ref: 208 M/M Task 32-40-00-710		
10 Grease Nose Torque Links and Nose Strut. Zone 700 Ref: 208 M/M Task 12-21-03-640		
11 Oil Shimmy Damper Pivot. Zone 700 Ref: 208 M/M Task 12-21-03-640		
12 Grease Main Wheel Bearings. Zone 700 Ref: 208 M/M Task 12-21-03-640		
13 Modified Steering Bungee Inspection Ref: Delcourt Aviation ICA # DA001		

Fuselage, Cabin

Task	Initial	
	LH	RH
1 Avionics Cooling Fan Operational Check. Zone 211, 212 Ref: 208 M/M Task 21-24-00-710		
2 Garmin Autopilot (GFC 700) Functional Check. Zone 226, 232 Ref: 208 M/M Task 22-12-00-720		
3 Garmin Autopilot (GFC 700) Slip Clutch Override Operational Check. Zone 226, 232 Ref: 208 M/M Task 22-12-00-710		
4 Inspect Portable Fire Extinguisher Ref: Bering Air GMM		

Fuselage, Cabin Continued

Task

Initial

- 5 Passenger Briefing System - Check briefing system for proper operation.
Ref: HUCAB User Manual
- 6 Perform Standby Flap Motor Ops Check.
Ref: 208 M/M CH 27-50-00-720
- 7 Emergency Power Lever Annunciator Light (EPL) Operational Check. Zone AUX
Ref: 208 M/M Task 76-10-01-710
- 8 Single Point Function Check - Verify condition, security & valve operation (no fuel truck needed, just program fuel into controller and confirm valves open after hitting start).
Ref: Wipaire Inc Single Point Installation Manual & POH Supplement
- 9 Engine Controls Functional Check. Zone 130, 211, 212, ENG
Ref: 208 M/M Task 76-10-00-720
- 10 Firewall Fuel Shutoff Valve Control Operational Check.
Zone 213, 214, 220
Ref: 208 M/M Task 28-21-00-711
- 11 Rudder Bar Bearings and Rudder Pedals Lubrication.
Zone 211, 212, 213, 214
Ref: 208 M/M Task 27-20-00-640
- 12 Crew Seats Detailed Inspection. Zone 231, 232
Ref: 208 M/M Task 25-10-00-220
- 13 Inertia Reel Operational Check. Zone 211, 232
Ref: 208 M/M Task 25-10-00-710
- 14 Flap Actuator Mount Bracket Detailed Inspection. Zone 231, 232
Ref: 208 M/M Task 27-50-00-220
- 15 Passenger/Cargo Compartment Lighting Operational Check. Zone AUX
Ref: 208 M/M Task 33-20-00-710
- 16 Crew Doors Detailed Inspection. Zone 801, 802
Ref: 208 M/M Task 52-00-00-220
- 17 Inspect passenger seats for general condition & complete Seat Spot Check.
Ref: AeroTwin Single Folding Seat STC & Bering Air GMM

Fuselage, Cabin Continued

- | Task | Initial |
|--|--|
| 18 Inspect Pax Lower Door Struts are Charged by Removal & Reinstallation
Ref: 208 M/M Ch 52 |  |
| 19 Inspect Pax Lower Door Struts are Not Over Extended when Door Fully Open.
Ref: Communique # SE-TP-004 & 208 M/M | |
| 20 Passenger/Cargo Doors and Door Frames Detailed Inspection. Zone 255, 256, 257, 258, 803, 804
Ref: 208 M/M Task 52-00-00-221 | |
| 21 Cargo Nets Detailed Inspection. Zone 251, 252, 255, 256, 257, 258
Ref: 208 M/M Task 25-51-00-220 | |
| 22 Verify Portable Scale Condition & Calibration
Ref: Bering Air GMM | |
| 23 Cargo Pod Drains Operational Check. Zone 901, 902, 903, 904, 905, 906
Ref: 208 M/M Task 25-52-00-710 | |
| 24 TKS Anti-Ice System Functional Check. Zone AUX
Ref: 208 M/M Task 30-11-00-720 | |
| 25 TKS System Pressure and Flow Functional Check. Zone AUX
Ref: 208 M/M Task 30-11-00-722 | |
| 26 Elevator Bellcrank Lubrication. Zone 213, 214
Ref: 208 M/M Task 12-21-02-640 | |

Wings

- | Task | Initial | | RII | |
|---|---|----|-----|----|
| | LH | RH | LH | RH |
| 1 Flight Controls Lubrication.
Zone 215, 216, 226, 373, 374, 503, 525, 603, 625
Ref: 208 M/M Task 27-00-00-640 |  | | | |
| 2 Stall Warning System Operational Check. Zone 211, 212, 503
Ref: 208 M/M Task 27-31-00-710 | | | | |
| 3 Pitot Tube Heaters Operational Check. Zone AUX
Ref: 208 M/M Task 34-11-00-710 | | | | |

Wings Continued

Task

Initial
LH RH

RII
LH RH

- 5 Fuel Reservoir Warning System Operational Check. Zone ENG
Ref: 208 M/M Task 28-41-00-710, 1.95-2.15 gal
- 6 Fuel Quantity and Low Fuel Warning Systems Functional Check. Zone AUX
NOTE: RII is for Installation of fuel line after draining.
Ref: 208 M/M Task 28-41-00-720
- 7 Wing Shutoff Valve Linkage Lubrication. Zone 231, 232, 511, 611
Ref: 208 M/M Task 28-23-00-640
- 8 Flap Tracks and Rollers Lubrication. Zone 525, 527, 625, 627
Ref: 208 M/M Task 27-50-00-640
- 9 Aileron Trim System Lubrication. Zone 211, 212, 217, 218, 233, 234, 253, 254, 251, 252, 551, 571, 651, 671
Ref: 208 M/M Task 27-10-02-640
- 10 Aileron Trim Tab Actuator (2661615-10) Lubrication.
Zone 551, 571, 651, 671
Ref: 208 M/M Task 27-10-02-642
- 11 Aileron Trim Tab (Free Play) Functional Check. Zone 551, 571, 651, 671
Ref: 208 M/M Task 27-10-02-720
- 12 Aileron System Functional Check. Zone 211, 212, 217, 218, 233, 234, 253, 254, 251, 252, 503, 525, 603, 625
Ref: 208 M/M Task 27-10-00-721
- 13 Spoiler System Functional Check. Zone 211, 212, 217, 218, 233, 234, 253, 254, 251, 252, 503, 525, 603, 625
Ref: 208 M/M Task 27-10-00-720
- 14 Flap Bellcrank Detailed Inspection. Zone 251, 252, 511, 611, 525, 625
Ref: 208 M/M Task 27-50-00-221
- 15 Flap System Functional Check. Zone 251, 252, 511, 611, 525, 625
Ref: 208 M/M Task 27-50-00-720
- 16 Fuel Vent Line Float Valve Operational Check. Zone 575, 675
Ref: 208 M/M Task 28-10-03-710

Wings Continued

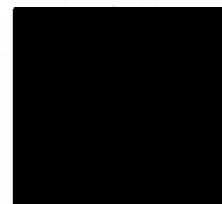
Task

Initial
LH RH

RII
LH RH

17 Fuel Filler Assembly Detailed Inspection. Zone 521, 621
Ref: 208 M/M Task 28-10-01-220

18 Sump all fuel tank drains.
Ref: 208 POH



Tail

Task

Initial
LH RH

RII
LH RH

1 Rudder Gust Lock - Inspect condition and general operation.
Ref: Aero Twin Gust Lock Kit ICA Doc # AT-RL-1001 ICA

2 Rudder System Functional Check (Standard Rudder Installation).
Zone 211, 212, 213, 214, 217, 218, 233, 234, 253, 254, 257, 258, 311, 312,
320, 341
Ref: 208 M/M Task 27-20-00-720

3 Left and Right Elevator Torque Tube Attach Points (Borescope)
Special Detailed Inspection. Zone 373, 374
Ref: 208 M/M Task 27-30-00-290

4 Elevator Trim Tab Actuator (2661215-9) Lubrication.
Zone 371, 372, 375, 376
Ref: 208 M/M Task 27-30-02-641

5 Elevator System Functional Check. Zone 211, 212, 213, 214, 217, 218, 233,
234, 253, 254, 257, 258, 311, 312, 320, 373, 374, 375, 376
Ref: 208 M/M Task 27-30-00-720

6 Elevator Trim Tab (Free Play) Functional Check. Zone 371, 372, 375, 376
Ref: 208 M/M Task 27-30-02-720

7 Inspect vertical stabilizer to rudder bonding straps for condition, security of
attachment, and chafing.
Ref: 208 M/M CH 20, 27



General Inspection Items

Task

Initial

- 1 Interior and Exterior Placard and Decal Detailed Inspection. Zone ALL
Ref: 208 M/M Task 11-00-00-220
- 2 Static Discharge System Functional Check. Zone 343, 375, 376, 571, 671
Ref: 208 M/M Task 23-60-00-720
- 3 Audit and correct math error Flight Record & Remove Complete Blue Copies.
Ref: Bering Air GMM

Hobbs: 3197.5 Landings: 6606

General Inspection Items Continued

Task

Initial

- 4 Check Status of G1000 Databases/ Update if needed or if updates are available.
Ref: 208 Garmin G1000 Line Maintenance Manual & Bering Air GMM
- 5 Verify All RII Functions Have Been Completed at the Completion of this Inspection Packet
Ref: Bering Air CAMP Manual
- 6 Placard Hobbs Meter with Inspection Due Time "3300.0"
Ref: Bering Air GMM
- 7 Update Bering Air Aircraft Status Sheet in Aircraft/Tin.
Ref: Bering Air GMM
- 8 Complete pre-flight walk around inspection at the completion of the inspection with extra focus on areas where maintenance was performed during the inspection.
Ref: 208 POH
- 9 Write up in the MDL to perform a Maintenance Flight because of Elevator & Aileron Trim Tab Lubrication was removed/installed.
Ref: Bering Air GMM
- 10 Verify aircraft Registration and Airworthiness Certificate are installed in the aircraft, legible, and Registration not expired.

12 Month 208B EX Inspection

N: 321BA Hobbs: 3197.5 AFTT: 3197.5 Landings: 6606
Unpaved Landings: N/A Airframe S/N: 208B5613 Date: 12/8/23
LH/Only Eng: PT6A-140 S/N: PCE-VA0701 ETT: 3197.5 ETC: 6606
RH Eng: N/A S/N: N/A ETT: N/A ETC: N/A

12 Month Inspection

Task

Initial

- 1 Key Lock Lubrication. Zone 801, 802, 803, 804, 921, 922, 923, 924
Ref: 208 M/M Task 12-21-07-640
- 2 Inboard TKS Wing Panel Pressurization Functional Check.
Zone 501, 601, AUX
Ref: 208 M/M Task 30-11-00-721
- 3 Main Landing Gear Detailed Inspection. Zone 721 722
Ref: 208 M/M Task 32-10-00-220
- 4 Drag Link Forward Support Seal General Visual Inspection. Zone 701
Ref: 208 M/M Task 32-20-00-210
- 5 Brakes Detailed Inspection. Zone 721 722
Ref: 208 M/M Task 32-40-00-220
- 6 Main Landing Gear Wheels and Tires Detailed Inspection. Zone 721 722
Ref: 208 M/M Task 32-40-00-222
- 7 Nose Landing Gear Wheel and Tire Detailed Inspection. Zone 710
Ref: 208 M/M Task 32-40-00-224
- 8 Engine Wash Ring, Air Plenum, and Thermocouple (T1) Detailed Inspection.
Zone 130
Ref: 208 M/M Task 71-41-00-220

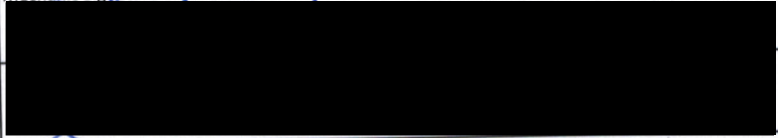
BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 1	Time Item or Discrepancy NLG Gravel Deflector 100 Hr Inspection Ref: Nose Gear Gravel Deflector ICA # NGD8-ICA	Name of Person Recording Discrepancy Dennis
Corrective Action <i>NLG Gravel Deflector 100 HR Inspection C/W IAEW above Ref- No Defects Noted</i>		
Mechanic Signature & Certificate # 		Pass or Fail <i>P</i>

Item# 2	Time Item or Discrepancy GI 275 12 Month Visual Inspection Ref: Garmin GI 275 STC M/M CH 3	Name of Person Recording Discrepancy Dennis
Corrective Action <i>C/W inspection, no defects noted</i>		
Mechanic Signature & Certificate # 		Pass or Fail <i>P</i>
RII Signature & Certificate # <i>[Signature]</i>		

Item# 3	Time Item or Discrepancy GI 275 Backup Battery Check Ref: Garmin GI 275 STC M/M CH 3	Name of Person Recording Discrepancy Dennis
Corrective Action <i>C/W BATTERY BACK UP TEST. RESULTS 98 MINUTES.</i>		
Mechanic Signature & Certificate # 		Pass or Fail <i>P</i>
RII Signature & Certificate # <i>[Signature]</i>		

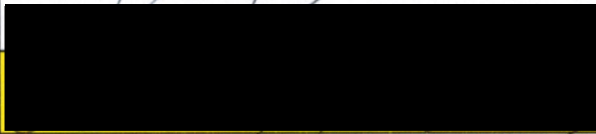
BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 4	Time Item or Discrepancy Flow Check Fuel Nozzles / Borescope Insp Ref: P&W M/M	Name of Person Recording Discrepancy Dennis	
Corrective Action <i>Reinstalled Nozzles after flow check by Heritage Turbines Inc w/ # 9661. Borescope inspection c/w no defects noted. Run up and leak check good</i>			
Mechanic Signature & Certificate # 		Pass or Fail PASS	

Item# 5	Time Item or Discrepancy Perform Engine Wash Ref: P&W M/M	Name of Person Recording Discrepancy Dennis	
Corrective Action <i>c/w Turbine wash.</i>			
Mechanic Signature & Certificate # 		Pass or Fail PASS	

Item# 6	Time Item or Discrepancy Insp & Replace Fuel/Oil Heat Exchanger Fuel Filter Ref: P&W CH 73-10-05	Name of Person Recording Discrepancy Dennis	
Corrective Action <i>Remove, Inspected & Replaced Fuel/Oil Heat Exchanger Filter IAW above Ref - No Defects Noted</i>			
Mechanic Signature & Certificate # 		Pass or Fail PASS	


BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo


AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 7	Time Item or Discrepancy Return to Service Sign-Off	Name of Person Recording Discrepancy Dennis
Corrective Action 12 Mo, 100 Hr, 200 Hr, 200 Hr/12 Mo, 400 Hr/12 Mo, 400 Hr/24 Mo, 800 Hr/12 Mo, 800 Hr/24 Mo, 1600 Hr/24 Mo, 1600 Hr/60 Mo Inspection was completed I certify that this aircraft has been inspected in accordance with Bering Air, Inc Continuous Airworthiness Maintenance Program (CAMP) and is approved to return to service at this time. Date: <u>12/8/23</u> Hobbs: <u>3197.5</u> AFTT: <u>3197.5</u> Cycles: <u>6606</u>		
Mechanic Signature & Certificate # 		Pass or Fail <u>T</u>
RII Signature & Certificate # 		

Item# 8	Time Item or Discrepancy A/C Drive Assembly Replacement Ref: CAL 21-02 Rev 0	Name of Person Recording Discrepancy Dennis
Corrective Action N/A by ship serial number and A/C not installed		
Mechanic Signature & Certificate # 		Pass or Fail <u>X</u>
RII Signature & Certificate # 		

Item# 9	Time Item or Discrepancy Co-Pilot Visor Tension knob Missing	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Installed new Co-Pilot sun visor tension knob IAW Cessna 209B mm 25-10-01 -No defects noted		
Mechanic Signature & Certificate # 		Pass or Fail <u>+</u>
RII Signature & Certificate # 		

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

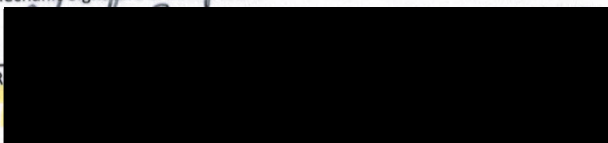
100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo


AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 10	Time Item or Discrepancy PLA Loose @ Engine	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Torqued & Safetied Input Power Lever Hardware as Required IAW P3WC PT6A-140 MM 76-10-01 - No Defects Noted		
Mechanic Signature & Certificate # 		Pass or Fail PASS

Item# 11	Time Item or Discrepancy Prop Control Cable Connection @ Governor Loose	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Torqued Attach Hardware as Required & Cotten Pinced IAW P3WC PT6A-140 MM 61-20-01 - No Defects Noted		
Mechanic Signature & Certificate # 		Pass or Fail PASS

Item# 12	Time Item or Discrepancy Stand-by Gen Mount Bolt Safety Wire Backwards	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Re-safetied Stand-By Gen Mounting bolt IAW Cessna 208B MM 20-10-20 - No defects noted		
Mechanic Signature & Certificate # 		Pass or Fail +
RII Signature & Certificate # 		



BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
13	Inertial Separator Top Control Rod End Doesn't have Large Corrective Action Area Safety Washer Installed Installed Missing Retaining Washer on Inertial Separator Top Push/Pull Control Rod End as Required IAW Cessna 208B MM 71-60-00 No Defects Noted	Christopher Rife
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
14	RT Brake Shim Broken Corrective Action Replaced Right Brake shim IAW Cessna 208B mm 32-40-00	Christopher Rife
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
15	Pilot Door Hinges Worn/Door Sagging Corrective Action Replaced Factory Door Hinge Pins with one size bigger as per CAB 96-2 - No Defects Noted	Christopher Rife
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

BERING AIR INC.
PO BOX 1650
NOME, AK 99762


100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 16	Time Item or Discrepancy Pilot Door Seals Torn	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced pilot Door Seals IAW Cessna 208B mm 52-12-00 - no defects noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # x			Pass or Fail x

Item# 17	Time Item or Discrepancy Passenger Chair Securing Rod has Incorrect Hardware	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Removed and replaced incorrect bolt with the correct one IAW Aero Turb, Inc. Single Place Folding seats Doc# ATFS1-ICA1 - No defects noted			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # b			Pass or Fail b

Item# 18	Time Item or Discrepancy LT Elevator Trim Actuator had Bad Rod End	Name of Person Recording Discrepancy Christopher Rife	
Corrective Action Replaced 1 Rod with new of same. C208B mm 27-30-02			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # in			Pass or Fail PASS


BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo

AFTT=Hobbs

MAINTENANCE DISCREPANCY SHEET

N# N321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 19	Time Item or Discrepancy Engine Oil Filter Housing Cover Nuts have Corrective Action Zero Run-On Torque Replaced NUTS with new of SAME. Ref PT6A-140 mm 79-10-01	Name of Person Recording Discrepancy Christopher Rife
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 20	Time Item or Discrepancy Pilot Stairs Assy has Loose Hardware Corrective Action Removed, cleaned, and Reinstalled hardware IAW Cessna 208B MM 52-61-00 -No defects noted	Name of Person Recording Discrepancy Christopher Rife
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

Item# 21	Time Item or Discrepancy Co-pilots Center Hinge Bolts too Tight Corrective Action Co-pilots Loosened, Lubricated, & Re-torqued hinge bolts IAW Cessna 208B MM 52-61-00 -no defects noted	Name of Person Recording Discrepancy Christopher Rife
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail 

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

100 Hr
200 Hr
200 Hr / 12 Mo
400 Hr / 12 & 24 Mo
800 Hr / 12 & 24 Mo
1600 Hr / 12 & 24 Mo

AFTT=Hobbs

N# N321BA


DATE 12/8/23


AFTT 3197.5

CYCLES 6606

MAINTENANCE DISCREPANCY SHEET

Item# 22	Time Item or Discrepancy LT Brake Cylinder on Pilot RT Rudder Pedal Leaking	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Disassembled, Replaced Stat-O-Seal, Back-up ring & O-rings, Reassembled & Reinstalled LT Brake Cylinder Cylinder on Pilot right Rudder Pedal IAW Cessna 208B mm 32-41-00 -no defects noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail +

Item# 23	Time Item or Discrepancy Radom Fillet Seal Needs Replaced	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Resealed Radom. C-208B mm CHAPTER 20-30-00		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail X

Item# 24	Time Item or Discrepancy Prop Needs to be Dressed	Name of Person Recording Discrepancy Christopher Rife
Corrective Action Dressed Propeller IAW McCauley Field Repair Service Memo: PRODSUP-16-38-CDB - No Defects Noted		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # 		Pass or Fail X

MAINTENANCE DISCREPANCY SHEET

N# 321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
25	Pilot Chair LT Armrest Missing Lg Area Washer	Christopher Rife
Corrective Action		
Installed Large Area Washer IAW Cessna 208B mm 25-10-00 - no defects noted		
Mechanic Signature & Certificate #		
		
RII Signature & Certificate #		Pass or Fail
t		t

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
26	Co-Pilot Seat LT AFT Seat Stop Bellcrank is Bent	Christopher Rife
Corrective Action		
Replaced seat stop Bellcrank IAW Cessna 208B mm 25-10-00 - no defects noted		
Mechanic Signature & Certificate #		
		
RII Signature & Certificate #		Pass or Fail
x		t

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
27	Sections of Cargo Pod Door Seals Missing	Christopher Rife
Corrective Action		
Replaced damaged sections of cargo door seal as required IAW Cessna 208B mm 25-52-00 - no defects noted		
Mechanic Signature & Certificate #		
		
RII Signature & Certificate #		Pass or Fail
t		t

MAINTENANCE DISCREPANCY SHEET

N# 321BA
DATE 12/18/23
AFTT 3197.5
CYCLES 6606

Item# <u>28</u>	Time Item or Discrepancy <u>Pilot Stairs have Excessive Play at Top Pivot Point</u>	Name of Person Recording Discrepancy <u>Christopher Rife</u>
Corrective Action <u>Replaced pilot stair mounting hinge bushings IAW Cessna 208B mm 52-61-00</u> <u>- no defects noted</u>		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # <u>X</u>		Pass or Fail <u>X</u>

Item# <u>29</u>	Time Item or Discrepancy <u>PAX Stairs FWD Cable Casing Torn</u>	Name of Person Recording Discrepancy <u>Christopher Rife</u>
Corrective Action <u>Replaced PAX stair FWD Cable IAW Cessna 208B mm 52-12-00</u> <u>- No defects Noted</u>		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # <u>X</u>		Pass or Fail <u>+</u>

Item# <u>30</u>	Time Item or Discrepancy <u>Steering Bungee Delcourt End Cap Installed Improperly -</u>	Name of Person Recording Discrepancy <u>Christopher Rife</u>
Corrective Action <u>Chafing on Bungee Mount</u> <u>Installed Delcourt Steering Bungee End Cap Properly as Required</u> <u>IAW Delcourt Installation Instructions # DA001 - No Defects Noted</u>		
Mechanic Signature & Certificate # 		
RII Signature & Certificate # <u>X</u>		Pass or Fail <u>2</u>

MAINTENANCE DISCREPANCY SHEET

N# 321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
31	Fuel Filler Cap O-Rings Require Replacement	Christopher Rife
Corrective Action Replaced LT & RT Wing Fuel Fill Cap O-Rings as Required IAW Cessna 208B MM 28-10-01 - Leak Checked Sat		
Mechanic Signature & Certificate # [Redacted]		
RII Signature & Certificate # [Signature]		Pass or Fail [Signature]

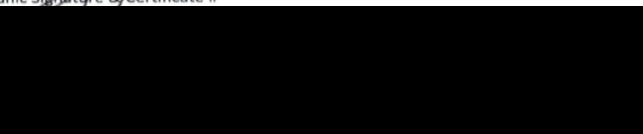

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
32	Landing/Taxi Lights Lens Dirty	Christopher Rife
Corrective Action Removed Landing/Taxi Light Lens, Cleaned & Reinstalled IAW Cessna 208B MM 33-48-05 - No Defects Noted		
Mechanic Signature & Certificate # [Redacted]		
RII Signature & Certificate # [Signature]		Pass or Fail [Signature]

Item#	Time Item or Discrepancy	Name of Person Recording Discrepancy
33	R/H Spoiler Hinge Pins Worn	Christopher Rife
Corrective Action Replaced center hinge pin with new of same. C-208B MM 157-70-00		
Mechanic Signature & Certificate # [Redacted]		
RII Signature & Certificate # [Signature]		Pass or Fail PASS

BERING AIR INC.
PO BOX 1650
NOME, AK 99762

MAINTENANCE DISCREPANCY SHEET

N# 321BA
DATE 12/8/23
AFTT 3197.5
CYCLES 6606

Item# 34	Time Item or Discrepancy BETA Block worn TO Limits	Name of Person Recording Discrepancy J	
Corrective Action Replaced BETA BLOCK with new of same C-208Bmm 61-40-00			
Mechanic Signature & Certificate # 			
RII Signature & Certificate # 			Pass or Fail PASS

Item# 35	Time Item or Discrepancy	Name of Person Recording Discrepancy	
Corrective Action			
Mechanic Signature & Certificate #			
RII Signature & Certificate #			Pass or Fail

Item# 36	Time Item or Discrepancy	Name of Person Recording Discrepancy	
Corrective Action			
Mechanic Signature & Certificate #			
RII Signature & Certificate #			Pass or Fail