

Destiny 20000

Serial No. 3C0533 N 65481

Manufacturer : Alliant Aviation


AIRCRAFT LOG

6
5771753215
MADE IN INDIA
9

S
★
T
★
A
★
R



I certify that this aircraft
has been inspected on 09/13/2007
in accordance with the scope and
detail of appendix D to part 43,
and was found to be in a condition
for safe operation.

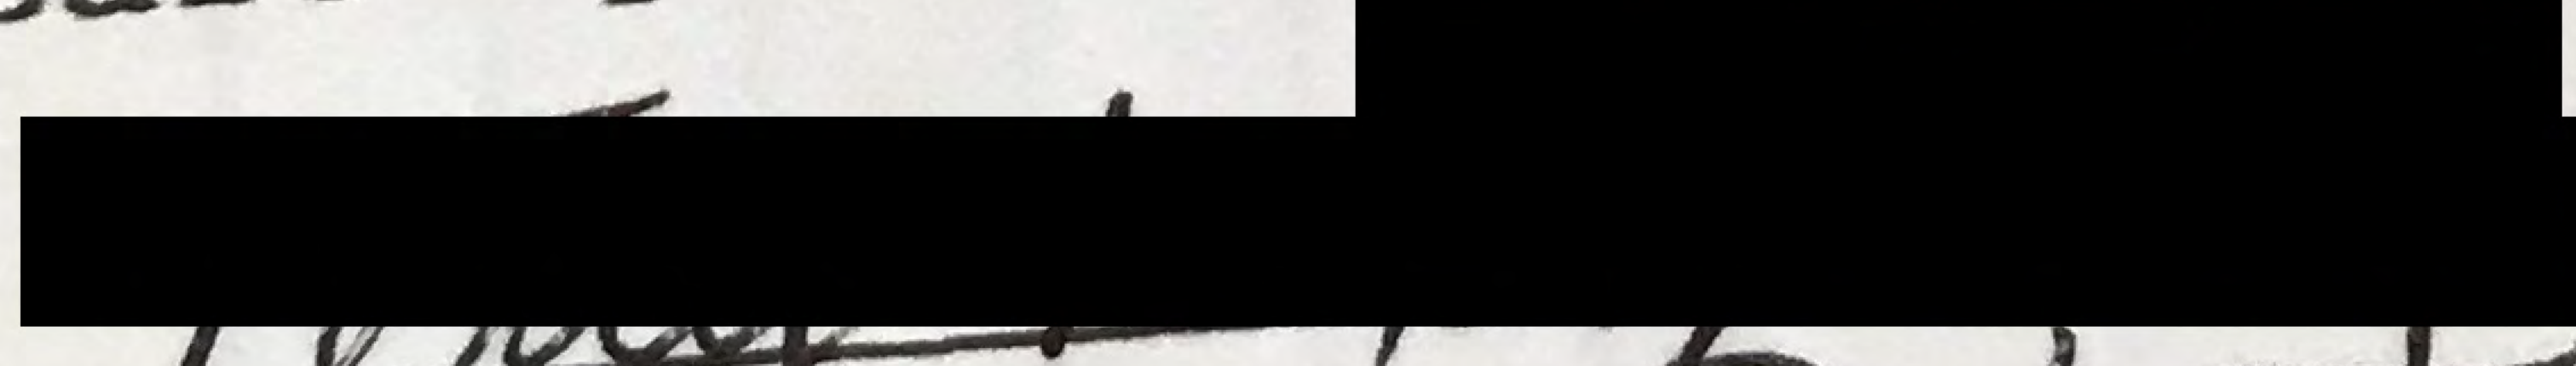Sign 

Print Terry L Dykstra

Time in service 634.6

[REDACTED]


I find that the aircraft meets
the requirements for the cert-
ification requested and have
issued a Experimental Light
Sport Airworthiness Certificate
dated 09/13/2007
the next inspection is due 9/3/08

signed [REDACTED]
Lowell Farrand [REDACTED]

I certify that the prescribed flight test hours have been completed and the aircraft is controllable throughout its normal range of speeds and throughout all maneuvers to be executed, has no hazardous operating characteristics or design features, and is safe for operation. the flight test was completed under the foll

owing conditions: maximum operating weight, 850 lbs. , Chiron 340 wing, 37 mph maximum demonstrated air speed with a 10 mph variation with a full flare.

643.6 Hrs
Sept 23, 2007

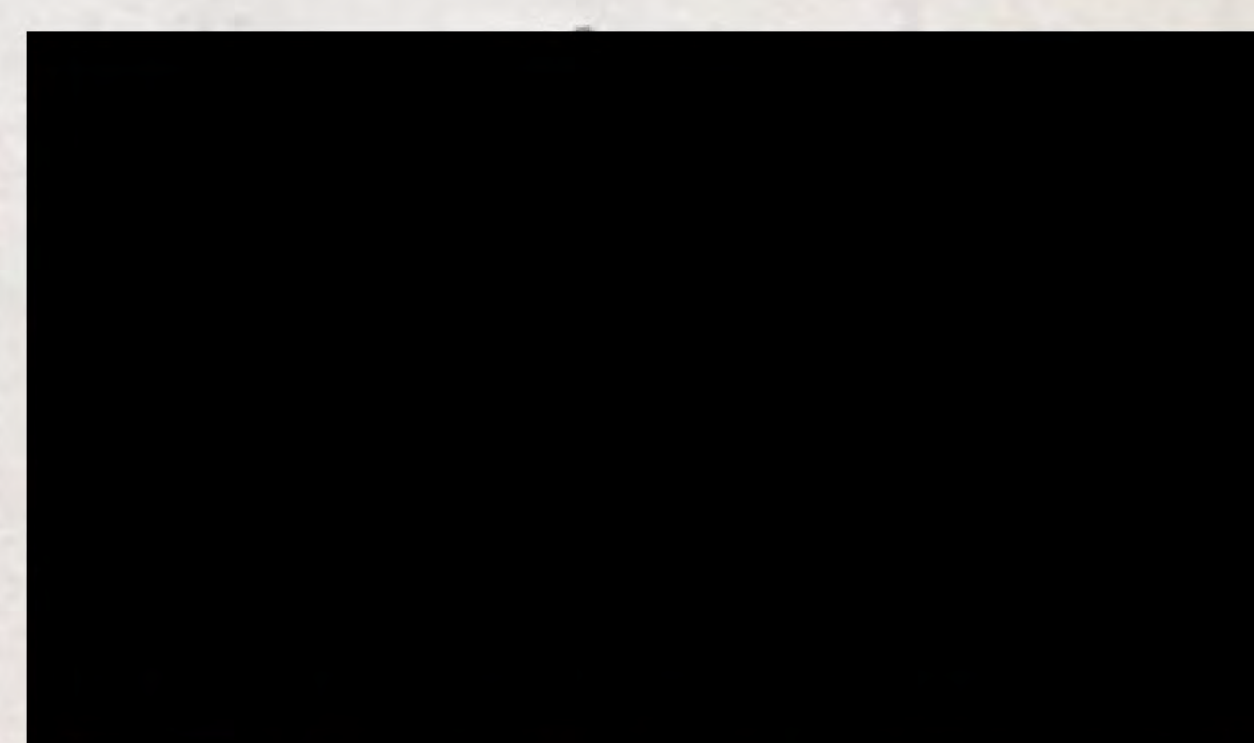

Date Hours

10-6-07 @ 650 hrs

- Change GL 85w-140 (14-15oz)
- Change Spark Plugs (gap @ .020)

3-18-08 @ 655.5 hrs

Install new exhaust manifold gaskets

Clean air filters

Put new cable through exhaust springs

9-13-08 @ 675.4 hrs

Change spark plugs, gap @ .020"

7-16-09 @ 701 hrs.

Change spark plugs, gap @ .020"

Change GL 85w-140 12-14ozs.

12-18-09 @ 716.2 hrs.

- Replace fuel/primer gas lines
- Replace spark plug cap on #3
- Replace gas filter/oil filter/line
- Clean air filters

5-1-2010 @ 719 hrs. Replace primer

6-8-2010 @ 724.3 hrs Change spark
plugs, .020" gap BR 8ES

12-23-2010 @ 744.6 hrs Change GL 85-140
clean AF's

✓ all bolts for tightness

1-21-11 744.6 hrs Change plugs gap @ .02

Replace carb. boots/rubber mounts

Remove carbs, clean, & inspect.

Replace needles soon 1162

I find that the aircraft meets the requirements for the certification requested and have issued amended Experimental Light Sport Certificate to aircraft, N 65481, Serial number 3C0533. The issuance of this amended certificate does not change the date of when the annual condition inspection is due.

Signed: _____

GL-09 Date: _____

01/28/2010

3-15-10

73 Hours total time since initial certification of aircraft

N65481

3-24-2010 Tach: & Total; 717.2 I certify that this Airframe has been inspected in accordance with an Annual Condition inspection per Appendix D of part 43 and was found to be in an airworthy condition.

Signed _____

A&P _____

IA

N65481

3-24-2010 Tach: & Total; 717.2 I certify that this Engine has been inspected in accordance with an Annual Condition inspection per Appendix D of part 43 and was found to be in an airworthy condition.

Signed _____

A&P _____

IA

1-22-12 776 hrs. Change plugs. ~~gap~~
gap @ .020"

Clean carbs

Bolt inspection/retighten

Rebuilt fuel pump

100 hr. inspection

Change GL

Change main jet, jet needle
+ needle jet/new

9-8-2012

798.2 hrs. - Change spark plugs
NGK BR8ES gap @ .020"

4-24-14

823 hrs. Change spark plugs

NGK BR8ES gap @ .020"

Clean carbs

N65481 Airframe & Engine Log Book Entry

04-26-2013 Tach & Total : 805.2
Compression Front 125lbs, Rear 120lbs.
Complied with an Annual Condition Inspection IAW
appendix D to part 43. I certify that this Engine was
found to be in an Airworthy Condition.

Signed

A&P

IA

4-28-15

840 hrs - Clean carburetor gas lines
change plugs, new water pump
new fuel filter and new battery
oil air filters TD

7-31-16

854 hrs. Change gear box oil TD

4-21-16

868 hrs. Plugs/new gap @ .020"
New pulse line TD

4-8-19 874 hrs

New fuel lines TD
Re-oil Air Filters

