





Wisconsin Aviation - Four Lakes, Inc



Shop Order:
Acct Number:



Sold To:



Aircraft Number:		N318RW		Type:Citation 560		S/N: 560-0051		
Total Time:		8,878.4		Hobbs Time: 8,129.6		Tach Time: LG Cycles: 6,506		
Eng#	Type	S/N		Time	Cycles	Prop Type	Prop S/N	Prop Time
1	JT15D-5A	PCE-108095		8,741.6	6,359			
2	JT15D-5A	PCE-108097		8,741.6	6,359			

Discrepancy: 1

Problem:

Severe turbulence inspection

Action Taken:

Complied with severe turbulence check (BTC).

Charges This Item:

Discrepancy: 2

Problem:

Toilet tank cracked at fitting.

Action Taken:

Found crack in outer layer of plastic and not through into main tank assembly. Leak checked good. No action required (S

Charges This Item:

Discrepancy: 3

Problem:

Toilet water flooded under the floor boards

Action Taken:

Removed lavatory drop floor panel and inspected under floor and found no evidence of toilet water under floor (BZ).

Charges This Item:

Discrepancy: 4

Problem:

Fire tray is de-bonded from the glareshield.

Action Taken:

Removed fire tray, re-bonded the nutserts into glareshield, reattached fire tray. OK for flight (JJN).

Charges This Item:

Miscellaneous Charges:

Summary:

Consum/Equip/TechPub: \$

Total Labor - \$

Totals:


SubTotal: \$



Wisconsin Aviation - Four Lakes, Inc



Total Charges:	\$
Amount Remaining:	\$

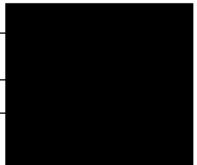

Please be aware when paying by credit card there will be a
3 percent processing fee.

Thank you for your business!

