

Aerospace Instrument Support, Inc. 1750 Westcourt Road Denton, Texas 76207 X17R807J
LOG ID# 1013 19-June-2019 WO# 15967
N6665U S/N CE-880 Beech F33A TACH 3927.2

Pg 1/1

**** ITEM # 15967-1 Install GTX-345 ****

DISCREPANCY: Install GTX-345

ACTION: Removed TDR-950 Transponder P/N 622-2092-001, S/N 13062 and all associated mounts, hardware and wiring. Installed and wired Garmin GTX-345 ADS-B In/Out Transponder P/N 010-01216-01, S/N 3EG026993 and all associated mounts, hardware and wiring. Tied into existing GNS-430w for position and display of ADS-B Traffic & weather. Installation done IAW Garmin STC SA01714WI and associated Install Manuals. Completed programming and testing IAW associated Install Manuals. ATC Transponder has been tested and found to comply IAW Part 43 Appendix F as required by FAR 91.413. ADS-B Out has been tested and found to comply IAW DO-260B certification.

**** ITEM # 15967-2 KI 256 S/N 11630 ****

DISCREPANCY: lazy and hangs, customer plane in hangar for install
Model: KI 256 Part#: 060-0017-00 Serial#: 11630

ACTION: Complaint verified. Removed KI-256 S/N 11630 for instrument shop. Disassembled unit, clean and polished airseals, vanes and vane stops. Replaced gimbal bearings and rotor. Assembled unit and calibrate. Clean and paint. Final test and inspect. Overhauled and certified per Bendix/King manual 006-05146-0002 Rev 2 8/1/1980
Reinstalled O/H KI-256 S/N 11630 and tested IAW Honeywell M/M. System checked good.

Signed

Bobby Faulks

Date

6/19/19

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

LOG ID#	10Z4	43-000	200	F33A
100000	S/N CE-880			Beech

DISCREPANCY: DG STICKS at 240
ACTION: Tested and could not verify. Removed DG KG-102A P/N 060-0015-00, S/N 11959; found gyro hasn't been looked at since 1980 and has corrosion on can and some pins. Installed O/H exchange KG-102A P/N 060-0015-00, S/N 16547 and tested IAW KCS-55A compass ICA. No other faults noted.

7/25/19


YEAR
20
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

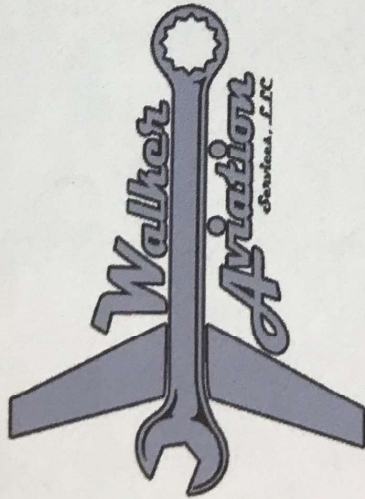

WALKER AVIATION SERVICES LLC (817) 629-3890

N6665U 10-11-2019 TACH - 3939.87

MODEL - BEECH F33A S/N - CE880 AFTT - 3939.87

PERFORMED AN ANNUAL / 100HR INSPECTION. INSPECTED ELT I.A.W. FAR91.207(d). LUBRICATED CONTROL SURFACE ROD ENDS & HINGES.

SERVICED FUEL STRAINER. SERVICED LH & RH TIP TANK TRANSFER PUMP FILTERS. REPLACED BRACKETT INDUCTION AIR FILTER ELEMENT. CHECKED LANDING GEAR RIGGING & OPERATION. LUBRICATED LANDING GEAR RETRACT SYSTEM. CHECKED EMERGENCY LANDING GEAR EXTENSION SYSTEM. SERVICED TIRES WITH AIR. SERVICED BRAKE FLUID RESERVOIR. CLEARED BUG NEST FROM RH, INBOARD FLUSH FUEL VENT. REPLACED RH AILERON CABLE TURNBUCKLE SAFETY WIRE WITH SAFETY CLIPS. CLEANED AREA OF LIGHT CORROSION FROM STRINGER UNDER CENTER FLOOR & TREATED WITH CORROSION-X. CHECKED IGNITION SWITCH OPERATION PER AD76-07-12. CHECKED A.D.s THROUGH BW2019-20. "I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL / 100HR INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION AT THIS TIME."

B. Michael Walker A&P/I.A.

10-11-2019

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

[illegible]