

INSPECTION RECORD

F.A.R. 43.11 - 91.217

DATE AIRCRAFT TIME IN SERVICE KIND OF INSPECTION - STATUS & DISCREPANCY LIST
SIGNATURE - CERT. NO. OF PERSON APPROVING OR DISSAPPROVING AIRCRAFT FOR SERVICE

08/24/24


ACTT 17,900.6 2,590.2 TACS

C/W AD 69-22-02, visually insp. CTL
Wheels (pilot + co-pilot) no cracks found
at this time. Next Due 2,690.2 TACS

C/W AD 93-05-06 - found point to be worn,
replaced worn parts IAW ACS SB92-01 Rev E,
ops checked ok, Next Due 4,590.2 TACS
or 19,900.6 TT.

ELT Not installed at this time.

This Aircraft has been insp. IAW Annual inspection
and has been determined to be in Airworthy condition

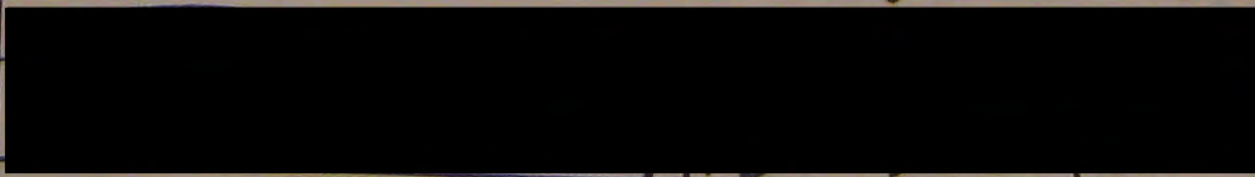

laced

08/17/24	2589.5	—	3632.1 TIE	—	Engine driven fuel pump leaking. Replaced fuel pump w/overhauled unit, P/N LW15472, SIN OHWR09. Performed engine run, leak checked g.d.
----------	--------	---	------------	---	--

