

Performance Air, Inc.



Pickens Airport (KLQK)

YEAR
20
DATE

02/24/17	SMOH (E) (R)189.2 (F) 429.1
A/CT T 2591.2	SPOH (P) (R)649.1 (F)00.00
N337J	HOBBS 1330.7

Inspected and serviced aircraft this date 2/24/17 I.A.W Cessna Service Manual pn# D2500-13.

(OPS tested ELT I.A.W 91.207 paragraph D) battery expires 4/2019

Replaced the following Items: Replaced both vacuum reg. filters pn# B3-5-1, replaced both air filters , made new brake hoses , resealed calipers and replaced brake linings, made all new fuel and oil hose front and rear engine, made new oil psi lines going to gauges under panel , made new

hoses going to aircraft heater, adjusted landing gear door sequence switch on hydraulic pak, repaired rear fuel flow gauge by cleaning stopped up fittings , replaced front and back hydraulic screen housing seals, adjusted governor speed front and back engines, troubleshoot engine monitor and was able to get operating per mfg of units manual, installed (1) new beacon lens,.

C/W the following A.D's; 11-10-09 C/W by visual/dimensional inspection, 76-07-12 Ops checked ~~no~~ defects

<see status sheets for further details>.

I certify that this aircraft has been inspected in accordance with an Annual inspection and was determined to be in airworthy condition.

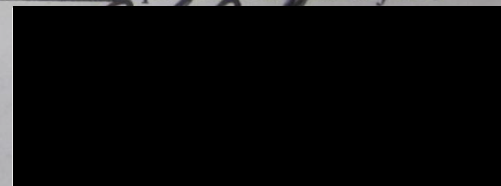


Photo 1 – Airframe logbook, annual inspection (FAA)

	Date	Total Time	Time Since Last Overhaul	
	Hrs.	Min.	Hrs.	Min.
Brought Forward				
2/24/15	183	8	183	8
Holds 1325/3				
Removed desiccant plugs & bags, replaced lower spark plugs, service oil w/ 9qt's Aeroshell 100AD, ran engine, check mag drops, prop action, hydraulic pump, ignition switch operation.				

Performance Air, Inc.
 Pickens Airport (KLOK)

02/24/17	SMDH 429 (F) 189.2(D)
A/C T 2591.2	PMAOH (P) 00.00(F) 649.1(R)
N337J	HOBBS 1330.7

Inspected and serviced engine this date: 2/24/17 I.A.W. Teledyne TSIO360 service manual pn# X-30596A

Compression are as follows #1 (74), #2 (78), #3 (76),
#4 (78), #5 (74), #6 (77)

Repaired and replaced the following parts. Serviced engine with (10) qts Phillips 20XC50 and (1) AA48110 oil filter.

C/W the following A.D.s: 13-21-02 N/A per sm's listed in body of AD. . <see status sheet for details>

I certify that this engine has been inspected in accordance with an 100 hr. inspection and was determined to be in airworthy condition.

[illegible]

Photo 2 – Rear engine logbook, annual inspection (FAA)


Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record Installations, Inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins
	Hrs.	Min.	Hrs.	Min.	
Brought Forward					
Performance Air, Inc.					
					
Pickens County Airport (KLOK)					
02/10/17	TSIO-360AB		sn#237626-R		
N337J	SMOH:		429.1		
Hobbs: 1330.7					
Installed engine this date 2/10/17 on N337J, sn# 337-1017 I.A.W Cessna 337 service manual and TSIO-360 service manual. Installed new engine mounts and bolts, made all new fuel and oil hoses, service engine with (1) new CH48108 oil filter and (10)qts Phillips 20XC50 oil, installed (1) new airfilter, all new exhaust gaskets and turbo gaskets.					
Performance Air Inc					
					
Pickens Airport (KLOK)					
02/24/17	SMOH		429.1(P)		
ACT 1	PSMOH (P)		00.00(P)		
2591.2	629.1(R)		18.88(S)		
N337J	1330.7				
Inspected and serviced engine this date: 2/24/17 I.A.W _ Teledyne TSIO360 service manual part X-30596A Compression are as follows #1 (_ 78 _), #2 (_ 77 _), #3 (_ 78 _), #4 (_ 79 _), #5 (_ 78 _), #6 (_ 74 _)					
Repaired and replaced the following parts: Serviced engine with (10) qts Phillips 20XC50 and (1) AA48110 oil filter.					
C/W the following A.Ds: 13-21-02, N/A per sn's listed in body of AD. - <see status sheet for further details >.					
I certify that this engine has been inspected in accordance with an 100 hr. inspection and was determined to be in airworthy condition.					

Photo 3 – Forward engine logbook, annual inspection (FAA)