


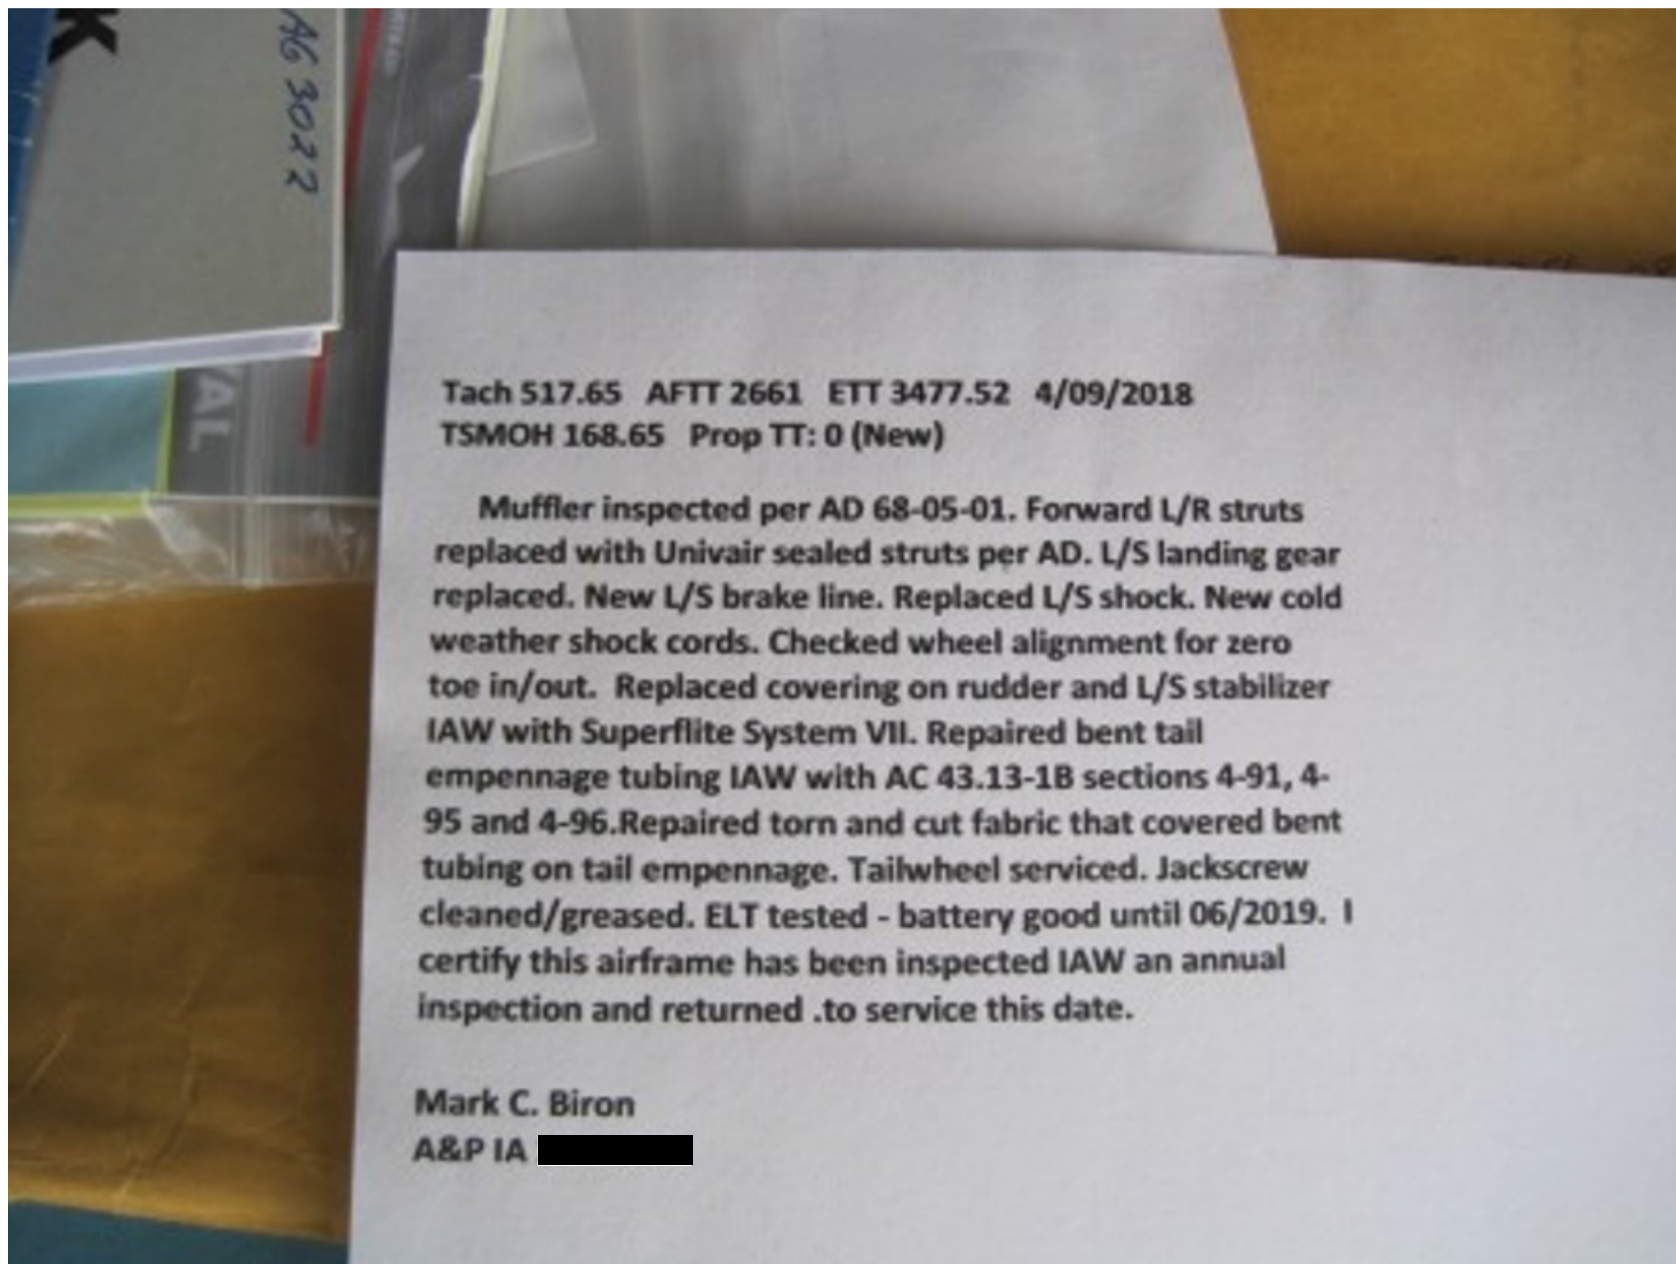

Tach 517.65 AFTT 2661 ETT 3477.52 4/09/2018
TSMOH 168.65 Prop TT: 0 (New)

Muffler inspected per AD 68-05-01. Forward L/R struts replaced with Univair sealed struts per AD. L/S landing gear replaced. New L/S brake line. Replaced L/S shock. New cold weather shock cords. Checked wheel alignment for zero toe in/out. Replaced covering on rudder and L/S stabilizer IAW with Superflite System VII. Repaired bent tail empennage tubing IAW with AC 43.13-1B sections 4-91, 4-95 and 4-96. Repaired torn and cut fabric that covered bent tubing on tail empennage. Tailwheel serviced. Jackscrew cleaned/greased. ELT tested - battery good until 06/2019. I certify this airframe has been inspected IAW an annual inspection and returned to service this date.

Mark C. Biron
A&P IA [REDACTED]

Photo 1 – Last Annual Inspection (AIRPLANE)

