



N26DC

DATE: 12/03/2020

Tach:1688.77

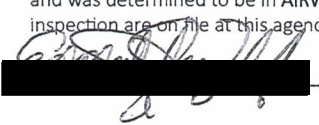
TTA 2680.79

Model: PA-32-260

SN: 32-64

Airframe

- Inspection and all work performed in accordance with Piper Aircraft service manual Part number 753-690 October 31,2019, STC:SA1013GL, SA1195GL, SA1217GL, SA609GL.
- Ads complied with biweekly
- CW AD 2020-24-05
- Lubed aircraft.
- R/R Rh wheel fairing Bracket w/ PN 63370-004 and wheel fairing support PN 66821-004
- Installed, Aerospace welding, overhauled engine mount.
- Installed McFarlane engine baffle kit PN PA32260-68.578PCOR
- Installed new control cable PN 455-361, governor cable PN 455-359 and control cable 455-360
- Installed new airbox valve PN 65142-007 and gasket PN63684-004.
- Installed overhauled Governor WO 18618 PN F-4-4A SN A8646T
- R/R fuel cap gasket with PN66815-000
- R/R wing root molding PN 187-526
- Installed 2 new cowl plates PN 69791-00, and seal cowl PN 65692-002 and 65692-003.
- All window seals: removed old seal, inspected, and sealed.
- Installed new ELT345 SN 317-03842 check done in accordance with 91.207. Battery exp
- Installed new clevis pins on main door PN 07-ADSC1
- Cargo, main, and rear passenger door seal R/R with new.
- Repaired and primed LH and RH elevator tips.
- Installed all four overhauled fuel senders PN 68101-002 SN (1) 202036 (2) 202035 (3) 202037 (4) 202038 see 8130 dated Aug 7, 2020 for further info.
- Installed new fabricated fuel tank hoses on LH and RH fuel tanks.
- Installed 4 fuel drain valves PNCCA-1550
- Installed new hardware on both fuel tanks PN 415-312 and 415-309.
- R/R brake linings w/ PN 066-10500, overhauled brake calipers, R/R O-ring MS28775-222, R/R LH brake plate pressure PN 757-208.
- R/R fabricated brake hoses on LH and RH mains.
- Installed new axel spacer PN63484-000 on RH main wheel and installed new axel nut PN 66820-000 on both mains.
- Corrosion X airframe.
- Shimmy damper serviced
- New battery installed PN RG-35AXC SN 41117462
- Installed new circuit breaker for Co2 detector PN7277-2-7.5 and replaced Co2 detector.
- R/R all air conditioning air vents.
- Installed Knots 2u: main gear wheel fairing, wing root fairing, flap hinge fairing, and straight wing gap seals.
- Performed ground run. No leaks or Abnormalities found at this time.
- Work performed IAW current FAA regulations.
- I certify that this airframe has been inspected in accordance with ANNUAL inspection and was determined to be in AIRWORTHY condition. Pertinent details of this inspection are on file at this agency under sales order S796396.


Edmar Marin-Mendez IA 



N26DC

DATE:12/03/2020

Tach:1688.77

TTE: 2680.77

ESMOH 0.00

Powerplant

Model: Lycoming O-540-E4B5

SN: L-9192-40

- Inspection and all work performed in accordance with Piper Aircraft service manual Part number 753-690 October 31,2019 Lycoming Service instruction 1427C
- Ads complied with bi-weekly
- Installed overhauled engine completed by Zephyr aircraft engines on 10-13-2020 under work order 220170.
- Serviced engine with 10qts Phillips X/C 20W50
- Installed new air filter w/ PN P617058
- Installed new alternator V-belt PN MC73965-015
- Installed new exhaust shroud w/ PN 69675-00 for further info see transport Canada authorized release cert tracking number 2019-8166 WO IQ966-4 dated April 26, 2019.
- Installed new lord engine mounts PN J-3804-27
- Installed new oil temp sensor probe w/ PN 3080-37
- Installed new engine hoses from precision hoses PN PA32-260 SN 64 kit
- Installed 5 new fuel primers PN 468-341
- Performed ground run. No leaks or Abnormalities found at this time.
- I certify that this engine has been inspected in accordance with ANNUAL inspection and was determined to be in AIRWORTHY condition. Pertinent details of this inspection are on file at this agency under sales order S796396

Edmar Marin-Mendez IA



N26DC

DATE:

Hobb:

Model: HC-C2YK-1PF

SN: CH40070B

Propeller

- Inspection and all work performed in accordance with Piper Aircraft service manual Part number 753-690 October 31,2019
- Installed Propeller overhauled by Sunstate propeller see 8130 for further info WO 18631 date Aug 22, 2020
- Performed ground run. No leaks or Abnormalities found at this time.
- I certify that this propeller has been inspected in accordance with ANNUAL inspection and was determined to be in AIRWORTHY condition. Pertinent details of this inspection are on file at this agency under sales order S796396.

Edmar Marin-Mendez IA