

[illegible]

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				

Dodge Center Aviation, LLC

Dodge Center Municipal Airport

802 South Airport Road
Dodge Center, MN 55927

Registration

N11HC

Date

9-14-2021

Model

Super II -S-FT

S/N

2329

TSO

MFG.

Glasair

Position

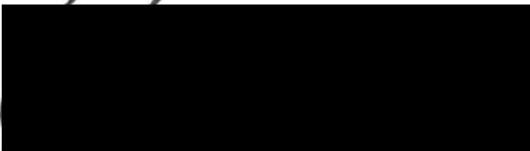

Tach

914.8

Total Time

914.8

Inspected ELT IAW FAR 91.207d, battery next due 2-2022. Psi checked cabin heat exchanger with no leaks noted. Replaced fuel filter on right firewall with new. C/W fuel filter SB's #101, 130, & 150. C/W alternate air SB's #91 & 117. Adjusted nose gear fork tension to specs. Lubed controls. I certify that this aircraft has been inspected on 9-14-2021 in accordance with the scope and detail of appendix D to part 43 and was found to be in a condition for safe operation.

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
				N11HC Hobbs: 900.4 10/07/2020 Removed GSN430W. Installed a new Avidyne IFD440 S/N M203482076 per Avidyne installation manual 600-00299-000. Configured and tested interface with Garmin G3X system. All tests good. Aircraft OK for return to service.   SteinAir Inc. FAA Repair Station V70R151B Jed Gregerson, Chief Inspector
				N11HC, Hobbs 968.9, Date 14 Apr 2021 R&R 01-1030-H-A - SUNSPOT 36 HX LANDING LIGHT WITH PULSE. R&R strobe relay with NAPA Echlin part #AR143. Philip Conway Experimental Repairman  issued 6-22-16