


N 7314D

#2

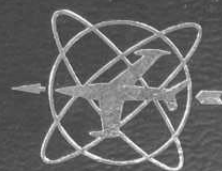

*The Standard*

# AIRCRAFT LOG

**ASA-SA-1**

**Aircraft Record** General Information

Manufacturer Air Tractor, Inc.

Model AT-502

Serial 502-0003

Registration Number N7314D

Date of Manufacture 1987

**Engine(s) currently installed:**

Manufacturer \_\_\_\_\_ Model \_\_\_\_\_ Serial \_\_\_\_\_

Manufacturer \_\_\_\_\_ Model \_\_\_\_\_ Serial \_\_\_\_\_

**Propeller(s) currently installed:**

Manufacturer \_\_\_\_\_ Model \_\_\_\_\_

HUB Model \_\_\_\_\_ Serial \_\_\_\_\_ Serial \_\_\_\_\_

Blade Model \_\_\_\_\_ Serial \_\_\_\_\_ Serial \_\_\_\_\_ Serial \_\_\_\_\_

Blade Model \_\_\_\_\_ Serial \_\_\_\_\_ Serial \_\_\_\_\_ Serial \_\_\_\_\_

| YEAR:                        | A.D. NUMBER | TOTAL TIME IN SERVICE | Airworthiness Directives<br>Chronological Listing of Compliance and Method of Compliance                                                                                                       |
|------------------------------|-------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 03/12/17                     |             | 3163.5                | Performed 100hr inspection on this airframe and found to be in an airworth condition and is approved for return to service. AEP [REDACTED]<br>Replaced engine Air filters (2) - AEP [REDACTED] |
| 04-04-2017                   | TTAF:       |                       | Performed an Annual Inspection using AirTractor                                                                                                                                                |
| Hops: 3189.4                 | 10,551.4    |                       | M.M as guide as well as FAR 43 app. D. Complied with AD research & compliance or those applicable at this time.                                                                                |
| AD#s                         | 2009-11-05  |                       |                                                                                                                                                                                                |
|                              | 2008-26-01  |                       |                                                                                                                                                                                                |
|                              | 2006-24-10  |                       |                                                                                                                                                                                                |
|                              | 2006-23-14  |                       |                                                                                                                                                                                                |
|                              | 2004-15-15  |                       |                                                                                                                                                                                                |
|                              | 2013-07-14  |                       |                                                                                                                                                                                                |
| 98-25-01, 97-14-05, 96-24-08 |             |                       | I certify that this airframe has been through an Annual Inspection, found to be Air worthy & thus returned to service. [REDACTED]<br>Christopher DeLeon<br>AEP# [REDACTED] IA                  |

through  
& there

[illegible]

N731AD

#3



*The Standard*

# AIRCRAFT LOG

ASA-SA-1

**Aircraft Record** General Information

Manufacturer

Air Tractor, Inc.

Model

AT-502

Serial

502-0003

Registration Number

N7314D

Date of Manufacture

1987

**Engine(s) currently installed:**

Manufacturer

Model

Serial

Manufacturer

Model

Serial

**Propeller(s) currently installed:**

Manufacturer

Model

HUB Model

Serial

Serial

Blade Model

Serial

Serial

Serial

Blade Model

Serial

Serial

Serial

| YEAR:<br>_____<br>DATE | RECORDING<br>TACH<br>TIME | TODAY'S<br>FLIGHT | TOTAL<br>TIME IN<br>SERVICE | <b>Description of Inspections, Tests, Repairs and Alterations</b><br>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)                                                                                                                                                                                                                                                                                                                                                                                   |
|------------------------|---------------------------|-------------------|-----------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 03/30/18               | 3460.8                    |                   |                             | Performed 100hr. Inspection on this airframe and found to be in an airworthy condition and is approved for return to service. Cleaned and insp. vertical mounting flange, adjusted plastic guide for elev. trim push/pull rod, replaced several Dzus recepticals/fasteners, repaired and/or replaced NAV bulb/recepticals, replaced Rt strobe light, brake pads Rt side, sheetmetal repair left side at step, checked batteries, replaced flap transmission, repaired white Nav light wire, wing attach angles - good, tightened bolt on left battery mount, fuel filters done, prop cleaned & greased. |
|                        |                           |                   |                             | <div style="text-align: right;">             Rep [redacted] / [redacted]           </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |

DATE: 4/1/2018

MODEL: AT502

S/N: 0003

REG NO: N7314D

AFTT: 3460.8

Hobbs: 10,822.8

Performed an Annual Inspection in accordance with the Air Tractor AT502 Inspection Checklist. Complied with the ICA's on the following installed equipment: Del Norte GPS, Zee Air Conditioner and Drift Finder Smoker System. No discrepancies were noted at this time. Removed, cleaned, treated and painted corrosion on both wings/flight controls. Replaced the RH/LH rudder cable with customer supplied cables. Replaced the rudder trim/elevator trim hardware with customer supplied hardware. Re-routed the aileron/rudder interconnect cable to prevent further chaffing onto the fuel pump hose. Lubricated and freed elevator trim control. Replaced the elevator bolt covers with customer supplied new. Tightened and installed missing screws on the inspection panels for both wings. **A.D. compliance list was added to the permanent records.** I certify that this **Aircraft** has been inspected in accordance with an **Annual Inspection** and was determined to be in airworthy condition. End

Rolando Rodriguez A&P [REDACTED] IA [REDACTED]

| YEAR:<br>DATE | RECORDING<br>TACH<br>TIME | TODAY'S<br>FLIGHT | TOTAL<br>TIME IN<br>SERVICE | <b>Description of Inspections, Tests, Repairs and Alterations</b><br>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)                                                                                                                                                                                                                                                                                                       |
|---------------|---------------------------|-------------------|-----------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|               |                           |                   |                             | <p>               DATE: 5/5/2018<br/>               MODEL: AT502<br/>               S/N: 0003<br/>               Complied with A.D. 09-11-05 by visual inspection of the engine mount ring clusters. No defects were noted at this time. End             </p> <p style="text-align: right;">               REG NO: N7314D<br/>               AFTT: 10,919.1<br/>               Hobbs: 3557.1             </p> <p style="text-align: right;">               Rolando Rodriguez A&amp;P [REDACTED] [REDACTED]             </p> |
|               |                           |                   |                             | <p>               DATE: 6/9/2018<br/>               MODEL: AT502<br/>               S/N: 0003<br/>               Complied with A.D. 09-11-05 by visual inspection of the engine mount ring clusters. No defects were noted at this time. End             </p> <p style="text-align: right;">               REG NO: N7314D<br/>               AFTT: 11,028.8<br/>               Hobbs: 3650.8             </p> <p style="text-align: right;">               Rolando Rodriguez A&amp;P [REDACTED] [REDACTED]             </p> |
|               |                           |                   |                             |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |

[illegible]