

ELT BATTERY DUE MAY 88 #2

AIRFRAME

DETROIT LAKES
24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q October 24, 2016 Tach 4562.5

Replaced LH and RH steering tube assemblies with new units. PN-MC0543022-4 & MC0543022-3. Replaced throttle cable with new MCC299505-02025. Replaced lower LH engine cowling mount with new PN-J-7444-14.

Signed Erik Carlson

Date 10-24-16

DETROIT LAKES
24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q April 7, 2017 Tach 4569.5

Complied with an annual inspection. Complied with ELT inspection IAW FAR 91.207(d). No defects noted at this time. Replaced air filter BA-4108. Replaced vacuum relief filter B3-5-1. Replaced orings on fuel strainer. Replaced flap indicator cable.

I certify that this aircraft has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.

Signed Erik Carlson

Date 4-7-17

DETROIT LAKES
24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q August 22, 2017 TT 4601.9

Replaced hobbbs meter P/N 85094-12. Old hobbbs removed at 1537.1. New hobbbs at 0000.0. Operational check good.

Signed Erik Carlson

Date 8-22-17

SUB-TOTAL this page

TOTAL—Carry forward to next page

OPTION OF WORK PERFORMED—
TIF

DETROIT LAKES
24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q May 23, 2018 ACTT/TT 4631.4

Complied with an annual inspection. Complied with ELT inspection IAW FAR 91.207(d). No defects noted at this time. Replaced battery. Next due 06/2020. Replaced air filter BA-4108. CW AD 2011-10-09 seat rail inspection. Next due 05/2019. CW AD 80-11-04 nut plate inspection. Next due 4731.4.

I certify that this aircraft has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.

Signed Erik Carlson A&P

Date 5-23-18

DETROIT LAKES
24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q April 19, 2019

Complied with Cessna SEL-27-02. Does not apply, kit not installed.

Signed Erik Carlson A&P

Date 4-19-19

REPLACE ELT BATTERY BY:

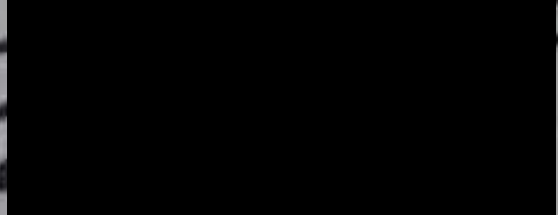
JUN 2020



24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q May 23, 2018 TT4631.4 TSMOH 2479.0

I certify that this propeller has been inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition.

Signed  Date 5-23-18
Erik Carlson A&P 

Page No. _____



24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q April 7, 2017 Tach 4569.5

Complied with compression check. Results as follows. #1-78/80, #2- 76/80, #3-74/80 and #4-74/80. Operational and leak checks satisfactory.

I certify that this engine has been inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition.

Signed _____

Erik Carlson A&P

Date 4-7-17

DESCRIPTION OF WORK PERFORMED—
TURE & CERTIFICATE NO. OF PERSON PERFORMING WORK

it forward from previous page

N# 5256Q TT- 4601.9 Hobbs- 1537.1

Drained oil, replaced filter with new unit P/N- AA48108-2 Serviced engine with 6 quarts of Aeroshell 15W50. Cut filter open, found no unusual contaminants at this time. Ground run and leak checks good.

Signed: _____

Date 8/21/2017



24813 Hwy 10 West Detroit Lakes, MN 56501



24813 Hwy 10W
Detroit Lakes MN 56501

N5256Q May 23, 2018 TT4631.4 TSMOH 813.4

Complied with compression check. Results as follows. #1-73/80, #2- 75/80, #3-75/80 and #4-76/80. Drained oil and replaced filter with new unit P/N CH48108-2. Serviced engine with 6 quarts of Aeroshell 15W50. Cut old filter open, found no unusual contaminants at this time. Operational and leak checks satisfactory.

I certify that this engine has been inspected in accordance with a 100 hour inspection and was determined to be in airworthy condition.

Signed _____

Erik Carlson

Date 5-23-18

N# 5256Q TT- 4677.4 Hobbs- 87.7

Drained oil, replaced filter with new unit P/N- CH48108-1. Serviced engine with 6 quarts of Aeroshell 15W50. Cut filter open, found no unusual contaminants at this time. Ground run and leak checks good.

Signed: _____

Date 12/11/18



24813 Hwy 10 West Detroit Lakes, MN 56501

S this page

arry forward to next page