



Photo 1 – Airframe Maintenance Records.

Page No. _____		DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK	
DATE	AIRFRAME TIME IN SERVICE	AVIONICS TIME IN SERVICE	
PAGE 2 of 2			
Replaced dorsal fairings PN RD0095-00 and RD0096-00. Replaced flap actuator rod ends PN 452-336. Replaced aircraft battery PN RG35AXC SN 40902221. Replaced air conditioner belt PN 73965-010. Replaced alternator belt PN 73965-009. Replaced condenser a/c grill PN 99550-002. Replaced two (2) EGT probes PN M-111. Installed Knots2U wing root fairings, Filed 337 on alteration. Aircraft weighted on calibrated scales and new weight and balance placed in POH. Leak test static system. Checked AD's thru Bi-weekly Issue 2018-05. See AD list book for PCW AD's. AD 78-23-01 fuel drain complied with by operational test due again at 3342.0. AD 76-07-12 hoses complied with by function test. AD 95-26-13 oil cooler hoses complied with by inspection due again at 3342.0, hoses due replacement by 3773.9. Test ELT in accordance with 91-207d, battery expires July 2018. Performed gear retraction test 10 cycles and one (1) emergency down cycle. I certify that this Aircraft has been repaired and inspected in accordance with an annual inspection and current Federal Aviation Administration regulations and found in airworthy condition. Detail on file under WO # 6051. Repair Station NO. Z4AR547Y Sammy Berezna			
AIR SERVICES, INC. PHO: (770) 836-9002 400 REGIONAL AIRPORT RD FAX (770) 836-6999 CARROLLTON, GA. 30117 FAA REPAIR STATION Z4AR547Y Airframe Log Book Entry 07/20/2018 N38523 TACH AND TTL: 3242.0 AD's checked thru Bi-weekly Issue 2018-14. AD 78-23-01 fuel drain complied with by operational test due again at 3342.0. AD 76-07-12 hoses complied with by function test. AD 95-26-13 oil cooler hoses complied with by inspection due again at 3342.0, hoses due replacement by 3773.9. Test ELT in accordance with 91-207d, battery expires July 2018 (ELT battery was ordered to be shipped to owner). Performed gear retraction test 5 cycles and one (1) emergency down cycle. I certify that this Aircraft has been repaired and inspected in accordance with an annual inspection and current Federal Aviation Administration regulations and found in airworthy condition. Detail on file under WO # 6227. Repair Station NO. Z4AR547Y Sammy Berezna			

Photo 2 – Annual inspection completed on 7/20/18.

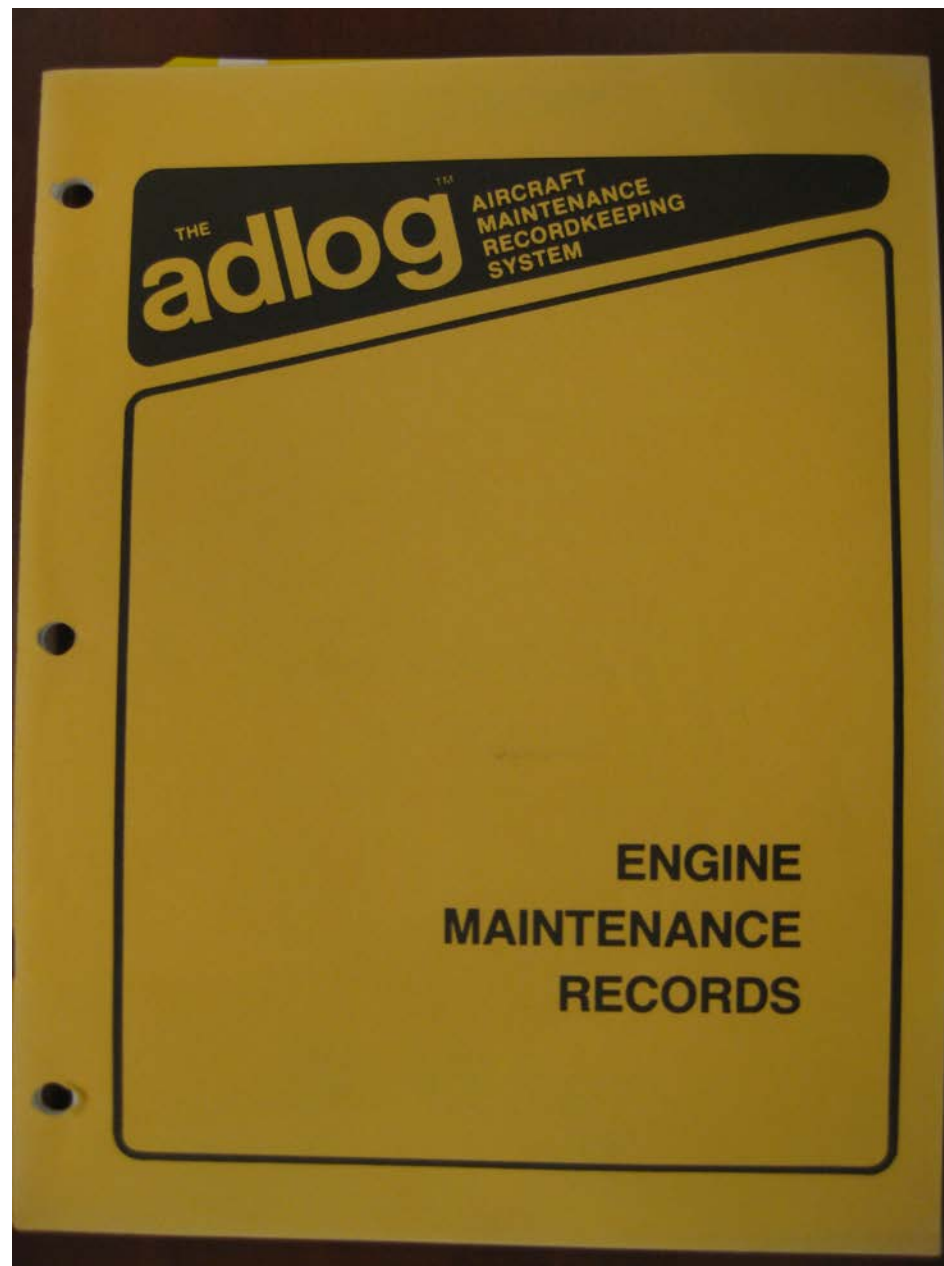


Photo 3 – Engine Maintenance Records

Page No

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
TOTALS brought forward from previous page				
AIR SERVICES, INC. 400 REGIONAL AIRPORT RD CARROLLTON, GA. 30117 FAA REPAIR STATION Z4AR547Y ENGINE Log Book Entry N38523 See Engine OH entry this date for AD's complied with at this time. AD's checked thru Bi-weekly Issue 2018-14. Performed runups, performance good – no leaks noted. Performed annual inspection in accordance with the scope and detail of FAR 43 Appendix D, check list used. I certify that this Engine has been repaired and inspected in accordance with current Federal Aviation Administration regulations and is approved for return to service. Details on file under WO # 6227. Repair Station NO. Z4AR547Y Sammy Bereznak PHO: (770) 836-9002 FAX (770) 836-6999 07/20/2018 Tach: 3242.0 TSMO: "0"				
AIR SERVICES, INC. 400 REGIONAL AIRPORT RD CARROLLTON, GA. 30117 FAA Certified Repair Station Z4AR547Y Airframe Log Book Entry N38523 Conducted operational check flight in accordance with FAR 91.407(b) 3 flights with 8 takeoff and landings – no defects noted/aircraft operates normally. PILOT BOBBY D. WATSON PHO: (770) 836-9002 FAX (770) 836-6999 July 18, 2018				
				SUB-TOTALS this page
				TOTALS—Carry forward to next page

Photo 4 – Annual inspection completed 7/20/18.