


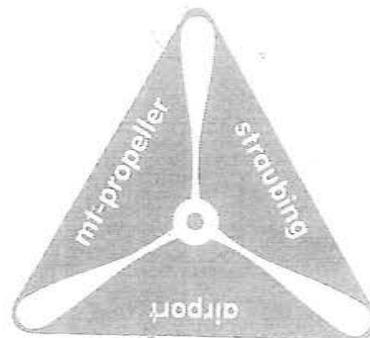

2B № 1

4R-E XG

mt-propeller

The Winner's Propeller

PROPELLER LOGBOOK

EASA DE.21G.0008 / EASA.21J.020

MTE - 1198
Juni 2005

MAINTENANCE & SERVICE HISTORY

[illegible]

Y

5

MAINTENANCE & SERVICE HISTORY


Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
			N710XP V-24L S/N: 14-03-05 PropTT: 62.5 Hobbs: 62.5 MTV-12-C-CF/CFLD180-57  <u>L PROPELLER</u> Inspected spinner for security and damage – found secure and free of damage. “This Propeller has been inspected on June 30th, 2016 in accordance with Condition Inspection, and was found to be in a condition for safe operation” Shaun Slade A&P # [REDACTED] [REDACTED]	June 30th, 2016

NOTE: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

MAINTENANCE & SERVICE HISTORY

Date		Authorized Signatures airman and Station Certificate Numbers
	Northwest Propeller Service, Inc.	
	[REDACTED]	
	Puyallup, WA 98374	
	REPAIR STATION No. IT6R625N	
	W/O 27546, Mfg.: MT Propeller, Model: MTV-12-G-C-F, S/N: 14250	
	Repaired: Disassembled, cleaned and visually inspected. Installed repaired blades by MT-Propeller USA, lubricated, assembled, checked angles and track and static balanced propeller per MT-Propeller Manuals E-220 Rev.57, E-808 Rev.10 and E-1290 Rev.31. Blade repair by MT-Propeller USA.	
	[REDACTED]	
	Inspector	15/NOV/2016
	Cert. No. [REDACTED]	
NOTE: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12		

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
N710XP Hobbs: 84.4 W.O.# 164376 Date: 28 Nov 2016 Removed L/H propeller p/n MTV-12-G-C-F, s/n 140250 and sent out for repair. Received repaired propeller and reinstalled on aircraft IAW MT Propeller Operation & Installation Manual #E-124 Issue #57 dated 8 Mar 2016. MAINTENANCE RELEASE <i>The unit identified above was repaired and/or inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service as airworthy with respect to the work performed. Pertinent details are on file at the Repair Station under the work order number stated above.</i> (Signature)   NEPTUNE AVIATION SERVICES, INC. MISSOULA, MONTANA 59808 				

NOTE: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12